

Firmware Release Note



Model: C2680

Date: 20-Mar-2017

V6.C6.04 FW addresses total of 24 issues.

- Major Changes

- 1) Allowed Searchable PDF and the PDF / A option to be applied together
- 2) Supported borderless printing as SFE56
- 3) Added Auto CR menu and functions to SWS > General Print

Please upgrade the FW with V6.C6.04 if any one of the problems below need to be resolved.

Version	Category	BTSP ID	Division	Change Description
V6.C6.04 (2017-03-20)	Problem	TP1680HW	SEG	Fixed an issue where home screen was shown instead of MyMFP screen when using MyMFP ISV solution
	Problem	SR-1601-000185	SEDA	Fixed an issue where the card was not logged out on the Home screen when using a dedicated card reader for the Equitrac ISV solution
	Problem	TP16B027	KOREA	Fixed an issue where the standard account was not initialized periodically after Wakeup
	Problem		SEBN	Fixed an issue where Web page could not be displayed when running AutoStore ISV solution
	Problem	TP16A0FH	KOREA	Fixed an issue where the entire SFE settings were initialized intermittently
	Problem	TP1670DS	SEBN	Fixed an issue where the self-signed certificate did not work when registered twice at SWS with the same name
	Problem	TP16502A	KOREA	Fixed an issue where the system was slowed down when using the device for a long time at DHCP network mode without connecting the network cable
	Problem	SR-1512-000319	SENA	Fixed an issue where the password of the FTP or SMB could not support :(colon sign)
	Problem	TP1640F8	SEAU	Fixed an issue where multiple emails could not be sent from some SMTP servers because multiple email recipients were handled against RFC 2822 standard Eg) To: 11@aa (X) --> To : 11@aa;22@bb (O) To: 22@bb
	Problem	TP16613F	SEA	Fixed an issue where IP information updated from DHCP was not immediately reflected in Noti Bar when network mode was DHCP
	Problem		KOREA	Fixed an issue where the life information transmitted to the Mib was displayed as a negative value when the consumable was used exceeding its life
	Problem	TP16C0C7	SEA	Fixed an IP conflict error when requesting ARP (Address Resolution Protocol) with IP 0.0.0.0 in order to obtain set information (MAC, IP, etc) at specific network equipment
	Problem	TP1650HM	SEG	Fixed an issue where text was not displayed when copying the text from a scanned Searchable PDF and pasting it into MS Word
	Problem	TP1660B3	SEA	Fixed an intermittent scan stop when using long and short media
Problem	TP16B083	SEG	Fixed an issue where the A5 LEF paper information was not retained after wakeup when using A5 LEF paper in a tray	
Problem	TP165005	SEA	Fixed an issue where the data was not printed if the print data contained garbage data	

Problem	TP169064	SENA	Fixed printing errors when requesting multiple remote jobs from Printing Security Core solution
Problem	TP1670VH	SEG	Fixed the connection slow down if there are thousands of files on the SMB server during Scan to SMB
Problem	TP16707Q	SEDA	Fixed an issue where the job accounting information set in FleetAdminPro was initialized when the device was rebooted in SWS or FleetAdminPro
Requirement	TP1690NP	SEDA	Improved compressive ratio in monoscan and OCR performance of PDF
Requirement	SR-1602-000490	SESA	Allowed Searchable PDF and the PDF / A option to be applied together
Requirement	TP16C0HQ	SEA	Supported borderless printing as SFE56
Requirement	TP16A098	SEDA	Provided API solution which enables to choose searchable PDF and PDF/A among PDF attributes
Requirement	TP1710JG	SEDA	Added Auto CR menu and functions to SWS > General Print

Software Component Versions

System Firmware	V6.C6.04
Main FW Version	V11.01.03.04_02-27-2017
XOA Framework Version	V1.28.0_06-25-2013
UP	14.5.20130715_cst130905
Engine Firmware	V1.00.07 170119
File System Version	FS_V16.00.00.00.30
SCB(Scan,Fax) Version	V3.00.01.05 01-23-2017
Boot Rom Version	V16.00.00.00.23-01-24-2017
UI Firmware	V5.36.00.03.10_2017022415
Tray1	V1.00.07 170119
Tray2	V0.03.06
PCL5CE	F8.13_161108
PCLXL	F11.00.87 11-08-2016
PS/PDF/XPS	F6.16.01.61.01.97_170119

Image Quality tables

EP	V1.10
Fuser	V1.95
TR	V0.02
Scan Control	V0.34
Print CMS	V1.1.5MR
Copy CMS	V2.3
Scan CMS	V1.4
Print IEM	V2.1
Copy IEM	V2.7

Update dependency

- None

Solution Compatibility Table

Category	Solution Name	Solution Version	V6.C6.04	Verified F/W Version
BCPS	SecureLoginCore	V2.01.012	○	V6.B6.03
	PrintingSecurityCore	V2.01.016	○	V6.B6.03
	DocumentWorkflowCore	V2.01.018	○	V6.B6.03
	UsageTrackerCore	V2.01.018	○	V6.B6.03

	XOA-WEB Enabler	V2.00.003	○	V6.B6.03
	CloudConnectorCore	V2.01.015	○	V6.B6.03
ISV-XOA-E	Omtool AccuRoute	1.0.0.689 (Server : 2013(Build 5))	○	V6.A6.19
	Drivve Image	1.5.43 (Server : 5.1.546)	○	V6.A6.19
	Drivve Print	1.1.30 (Server : 3.1.100)	○	V6.A6.19
	Equitrac	EQLogin_1.1.0.98.par (Server : 10.52.1.23)	○	V6.A6.19
	Ringdale FollowMe	1.1.2.9 (Server : v6.1.0.103)	○	V6.A6.19
	Geniusbytes MyMFP	2.14.10.4 (Server : 2.16.12)	◎	
	PaperCut	1.1.0 (Server : 16.0 (Build 35320))	◎	
	SafeCom	010.24.18 (Server : 10.52.7.2(S82070.520*07))	◎	
	SafeQ Embedded Terminal	1.0.0 (Server : C.0.18.0002)	◎	
	Scanner Vision	1.0.6 (Server : 6.2.0.270)	○	V6.A6.19
	Prism ScanPathTM	1.0.49 (Server : 2.5.0.29)	○	V6.A6.19
	Scanshare Essentials	1.5.10.163 (Server : V4.0.5)	○	V6.A6.19
	Ubiquitech Easy & VDMS	1.5.3-rel2 (Server : 5.0.0)	◎	

◎ A solution has been verified and MUST be compatible with the releasing F/W version.

○ Previously the supported solutions have been tested and verified with the version specified in the "Verified F/W version" row in the table. The required test has been conducted on this FW version to ensure the backward compatibility with "Verified F/W version".