Firmware Release Note

Model: M4580 Series Date: 12-Dec-2019

V5.H6.00 FW addresses total of 3 issues.

- Major Changes
- 1) Fixed, the toner remaining issue to print.
- 2) Removed the functionality to print the barcode.
- 3) Fixed, the SNMP OID status for HCF tray to display it on the panel.

Please upgrade the FW with V5.H6.00 if this problem need to be resolved.

Version	Category	TSP ID	Division	Change Description
115 TT C 00	Problem		Korea	Removed the functionality to print the barcode.
V5.H6.00 (2019-12-12)	Problem		Korea	Fixed, the toner remaining issue to print.
(2017-12-12)	Problem		Korea	Fixed, the SNMP OID status for HCF tray to display it on the panel.

Software Component Versions

Software Component versions	
System Firmware	V5.H6.00
Main FW Version	V11.01.13.00_09-20-2019
XOA Web	1.4.33
UP	1.17.34_(20171218171009)
Engine Firmware	V1.00.25
File System Version	FS_V14.03.06.19.13
SCB(Scan,Fax) Version	V3.00.04.02
Boot Rom Version	V13.10.00.00.93-04-25-2019
UI Firmware	V5.18.50.12.00_19040115
Tray1	V1.00.24
Tray2	V2.00.01
Tray3	V2.00.01
Tray4	V2.00.01
PCL5CE	V8.22_170906
PCLXL	V11.00.87
PS/PDF/XPS	V6.21.01.62.02.03_170415

Image Quality tables

mage Quarty tables	
EP	V8.00
Fuser	V1.60
Toner	V1.70
TR	V5.50
Print CMS	V1.9
Copy CMS Scan CMS	V2.3
Scan CMS	V1.81
Print IEM	V0.5
Copy IEM	V0.9

Update dependency

- If the previous firmware version is lower than V5.C6.03, please install Service Pack first, which is needed to prevent delay in upgrading all UI firmware

Solution Compatibility Table (M4580 :V5.H6.00)

Category	Solution Name	Solution Version	V5.H6.00	Verified F/W Version
	CloudConnectorCore	2.50.008	0	
	DocumentWorkflowCore	2.50.007	0	
BCPS	PrintingSecurityCore	2.50.009	0	
всго	SecureLoginCore	2.50.006	0	
	UsageTrackerCore	2.50.007	0	
	XOA-WEB Enabler	2.00.003	0	V5.D6.04
	Autostore	1.0.0 (Server : 7.00.3.0 (DRS:7.0.1.16, APD:7.0.3.26))	0	V5.E6.04.02.060911
	Drivve Image	1.5.43 (Server : 5.1.546)	0	V5.C6.03
	Drivve Print	1.1.30 (Server : 3.1.100)	0	V5.C6.03
	Equitrac	1.1.0.135 (Server : 5.2.21.8778)	0	V5.D6.14.03.120609
	Geniusbytes MyMFP	2.19.6.2 (Server : 2.19.3)	0	V5.G6.01.03.050715
	NDDigital n-Access	2.1.3 (Server : NDDigital n-Billing 4.9)	0	V5.D6.04

	NDDigital n-Collector	2.2.4 (Server : NDDigital n-Billing 4.9)	0	V5.D6.04
	NDDigital n-Releaser	2.1.4 (Server : NDDigital n-Billing 4.9)	0	V5.D6.04
	Omtool AccuRoute	1.0.0.689 (Server : 2013(Build 5))	0	V5.D6.04
ISV-XOA-E	PaperCut	1.1.0 (Server : 16.4 (build 38954))	0	V5.F6.01
	PrintFleet Cloud Embedded DC	1.1.249 (Server : 3.6)	0	V5.E6.04.02.060911
	Ringdale FollowMe	1.1.2.9 (Server : 6.1.0.103)	0	V5.D6.04
	SafeCom	010.24.23 (Server : 10.520.10.35)	0	V5.F6.04.03.092016
	SafeQ Embedded Terminal	1.0.0 (Server : C.0.18.002)	0	V5.D6.14.03.120609
	Scanner Vision	1.0.6 (Server : 6.2.0.270)	0	V5.D6.04
	Scanshare Essentials	1.5.15.167 (Server : 4.0.5)	0	V5.D6.04
	Ubiquitech Easy & VDMS	1.5.3-rel3 (Server : 5.0.0-rel [ca91b])	0	V5.D6.14.03.120609
	e-Paper Sentinel	5.0.7	0	V5.D6.04
	Prism ScanPathTM	1.0.49 (Server : 2.5.0.29)	0	V5.C6.03
SmartUX	Nuance unified client	1.0.0.606 (Server : 5.7.28.6490(CAS:5.7.28.6490, APD : 7.0.4.0))	0	
PrinterOn	PrinterOn Branded Agent	2.03.003	0	V5.F6.04.03.092016

 $[\]ensuremath{\bigcirc}$ A solution has been verified and MUST be compatible with the releasing F/W version.

FW Release History

Version Version	Category	TSP ID	Division	Change Description
	Problem		Korea	Fixed, XSS weak point of Samsung models.
	Problem		Korea	Fixed, slow UI and slow copy feature.
	Problem		Korea	Fixed, IPv6 manual address for fdxx as prefix.
	Problem		Korea	Fixed, S5-3116 if no hardware failure.
V5.G6.01.03. 050715	Problem		Korea	Implementation of new requirement to enhance the SWS security.
(2019-05-30)	Problem		Korea	Fixed the IDCopy parameter getting reversed while submitting of job.
(======================================	Problem		Korea	Fixed, to print all documents in queue from BCPS when documents come from MacOS.
	Problem		Korea	Fixed the issue of device going to home screen after login using GeniusMFP solution.
	Problem		Korea	Fixed, Manual Reset of device quota reset policy.
	Problem		Korea	Fixed, android security issue for password field.
V5.G6.01 (2019-01-28)	Problem		Korea	Fixed the UI slowness issue which use to happen after adding more widgets at home and mahcine was not rebooted for 2 to 3 days.
	Problem		KOREA	Fixed the issue that image log not sent to Printing Security Solution Server when fax images recieved through Line2
	Problem		DEV	Fixed the issue of WSD Print installation with Win10 (1703/1709/1803)
V5.F6.04.03. 092016 (2018-11-01)	Problem		DEV	Fixed the Google Address Book stay signin issue and showing previous user contacts
	Problem	SIE174695	EMEA	Fixed the issue of Box app Athentication
	Problem		DEV	Fixed MFP slow down issue with mDNS
	Problem	SIP68753 TP174000	EMEA	S1-2452 Error issue was fixed by improving the DB recovery logic
	Problem		DEV	When SNMP Community Web Service is called via HPSM application to add/edit/delete the community names, a side effect is observed that SNMPv3 is getting disabled. This side effect is fixed
V5.F6.04.02. 071215 (2018-08-01)	Problem	SIP68582	AMS	Fixed SMB 2/3 job failed issue due to excessive permissions requested
(2010 00 01)	Requirement		DEV	SNI(Server Name Indication) is added by new requirement for Google Cloud Print servers when SSL enabled.
	Requirement		DEV	New feature implementation for configurable 'SSL/TLS' protocols and ciphers option. Security level configuration can be done according to user requirement from SWS.
	Problem	TP1790KD	SEAU	'Error 403' caused when connecting to Google Addressbook due to Google policy changes is fixed.
	Problem		DEV	The intermittent stoppage caused when creating Hibernation Image when https is enabled is fixed.
	Problem		DEV	Inaccurate range value associated with Scan background density from Nuance Unified client compatibility test is fixed.

O Previously the supported solutions have been tested and verified with the version specified in the "Verified F/W version" row in the table. The required test has been conducted on this FW version to ensure the backward compatibility with "Verified F/W version".

Problem Problem Problem Problem Problem SER Ocerwrite is enabled is fixed.	 				The ions that file stored at Poy Apr is not intermittently deleted at the desired when UDD I
Problem Selan Topin speech in supervised without seland stream value is acreast as default after changed FW version including updated sheaf App is installed in Stead.	VE EC 04 01	Problem	TP17A06W	SEA	The issue that file stored at Box App is not intermittently deleted at the device where HDD Image Overwrite is enabled is fixed.
Problem SP65701 SEG The issue that certificate related setting value is need as default after changed FW version including updated Sex App is installed is fixed.		Problem		SEBN	Login speed has improved when using Nuance Unified client.
Problem SPES-94 SPAU the device enteres sleep is fixed.		Problem	SIP65701	SEG	-
Sequirement Set159265 SAU included in sender's user name is fixed.		Problem	SIP64544	SEAU	The issue that fuser detection fails due to intermittent timing in case that a user sends a job when the device enters sleep is fixed.
Problem Sef Copy sharpness value change failure on FAP is fixed.		Problem		SAU	The issue that email is not delivered under ScantoEmail in case that special characters(ex) ',') are included in sender's user name is fixed.
Problem FMEA Special characters except for "o" and "o" are now allowed as LDAP server access password.		Requirement	SIE157066	EMEA	New certificate of Google Cloud server is applied.
NS.16.04 Problem No. No. Change to define start and end time when enabling performance optimization feature.		Problem		SEG	Copy sharpness value change failure on FAP is fixed.
Problem F. CUR Change to estrins start and call time when channing performance optimization reasure.		Problem		EMEA	Special characters except for '<' and '>' are now allowed as LDAP server access password.
Problem SEG in PCLS job for color printers. Problem Problem Fried an issue of the sex dualbase menu being displayed at booting phase by intermittent corruption of audit dualbase index. Problem TP178011 SEBN Fixed an issue of the rest dualbase menu being displayed at booting phase by intermittent corruption of audit dualbase index. Problem TP17201901 KOR Allow Korean characters in the Scan to SMB path.		Problem	-	KOR	Change to define start and end time when enabling performance optimization feature.
Problem TP17801L SEBN Fixed an issue of the sext database membering displayed at booting phase by intermittent corruption of audit database index.	V5 E4 01	Problem	-	SEG	Fixed an issue of unintended color being printed because of wrong processing of 1x1 size pattern in PCL5 job for color printers.
Problem TP17801L SEBN Fixed an issue of the reset database menu being displayed at booting phase by intermittent corruption of audit database index. Problem TP17203901 KOR Allow Kurean characters in the Scan to SMB path. Problem TP1740C3 SEA Fixed an issue of iterated login and logout when performing NFC authentication on device, WIFINFC module(SL-NEW001X) installed, with the latest cellular phones such as Galaxy SB. Fixed an issue of silver booting or WIFI disconnection when power cycled by soft power button on UT when WIFI/Blaetooki (BLE, Bluetooth Low Energy) module(SL-NWE002X) installed. Problem TP174000 SEUK Improve DB(Database) error recovery routine for damaged record only instead of DB initialization. Problem TP17500A SEG Allow compact PDF option in XOA-E API for IXV Solutions. Fixed an issue of the memory clear button in the service menu not being activated after power or but intermittent exception occurred in WSD initialization. Allow compact PDF option in XOA-E API for IXV Solutions. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Problem TP177025 SEHK Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message and to the decoded by corrupted data. Requirement TP1710K1 SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710DK SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710DK SEA Alow and insulation of the policy of the season of problem while spooling data to HDD. Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs was not printed intermittently due to problems while spooling data to HDD. Fixed an issue that when a large number of print jobs were saved in the Box,		Problem	-	KOR	Fixed an issue of black text printed as white in specific application for color printers.
Problem DEV Fixed an issue of iterated login and logout when performing NFC authentication on device, WIFI/NFC module(SL-NEWO1X) installed, with the latest cellular phones such as Galaxy S8. Problem TP1740C3 SEA Fixed an issue of slow booting or WIFI disconnection when power cycled by soft power button on UI when WIFI/Bluetooth (BLE, Bluetooth Low Energy) module(SL-NWE002X) installed. Improve DBD/Batabase) error recovery routine for damaged record only instead of DB initialization. Problem TP176005 SEI SEA SEA Allow compact PDF option in XOA-E API for ISV solutions. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Problem TP177025 SEH Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Problem TP1710KL SEAS A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710KL SEAS A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Problem TP1710XL SEG Fixed an issue where one continuous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP170BC SEA Added a new settings which specifies a default folders of Box App. Problem TP1740DR SEU Fixed an issue where one continuous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1740DR SEU Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEU Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEU Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not pr	(2017-10-27)	Problem	TP17801L	SEBN	- · · · · · · · · · · · · · · · · · · ·
Problem TP1740C3 SEA Fixed an issue of slow booting or WIFI disconnection when power cycled by soft power button on UI when WIFI/Bluetooth (BLE, Bluetooth Low Energy) module(SL-NVEROLX) installed. WS.E.6.04.04. 409410 Problem TP174000 SEUK Improve DBD(Database) error recovery routine for damaged record only instead of DB initialization. Problem TP176005 SEI Fixed an issue of the memory clear button in the service menu not being activated after power or but intermittent exception occurred in WSD initialization. Problem TP17500A SEG Allow compact PDF option in XOA-E API for ISV solutions. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Problem TP177025 SEHK Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. SEAA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1740DC SEA Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settings > Default Display Folder Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Fixed an issue that		Problem	TP1720J901	KOR	Allow Korean characters in the Scan to SMB path.
VS.E6.04.04. Problem P1740C3 SEM on UI when WIFL/Bluetooth (BLE, Bluetooth Low Energy) module(SL-NWE002X) installed. Improve DB (Database) error recovery routine for damaged record only instead of DB initialization. Problem P176005 SEI Fixed an issue of the memory clear button in the service menu not being activated after power or but intermittent exception occurred in WSD initialization. Problem P77500A SEG Allow compact PDF option in XOA-E API for ISV solutions. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. Requirement TP1700KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP170LC SEA Added a new settings which specifies a default folders of Box App. Problem TP170DR SEUK Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Requirement TP1740DR SEUK Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16COIQ SEA Fixed an information from of "From" email address at the Scan to email function. exp. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16COIQ SEA Fixed an information in the service mode. Added a reset button to Service Menu > Mainte		Problem	-	DEV	
Problem TP174000 SEUK Initialization. Fixed an issue of the memory clear button in the service menu not being activated after power or but intermittent exception occurred in WSD initialization. Problem TP17500A SEG Allow compact PDF option in XOA-E API for ISV solutions. Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. Requirement TP170KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710KL SEG Fixed an issue where one of continuous printing jobs was not printed intermittently due to problem SEG Fixed an issue where one of continuous printing jobs was not printed intermittently due to problems while spooling data to HDD. Added a new settings which specifies a default folders of Box App. Problem Problem DEV Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & D		Problem	TP1740C3	SEA	
Problem TP176005 SEI but intermittent exception occurred in WSD initialization. Problem TP17500A SEG Allow compact PDF option in XOA-E API for ISV solutions. Problem TP177025 SEHK Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement already. Problem TP177025 SEHK Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Problem TP177025 SEHK Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Problem TP1710KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1710JAG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP1710JA SEG Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16AOSB SEUK Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rrese		Problem	TP174000	SEUK	
Problem - DEV Fixed an issue of a fuser replacement message not disappearing even though turning off fuser replacement alarm. Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data. Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. Requirement TP1710KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Requirement TP1670QW SEA Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16AOSB SEUK Added a Fave tbutton to Service Menu > Maintenance Counts > Jam Count menu Problem TP16COJQ SEA Fixed in intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.	(2017-09-20)	Problem	TP176005	SEI	Fixed an issue of the memory clear button in the service menu not being activated after power on but intermittent exception occurred in WSD initialization.
Problem TP177025 SEHK Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. Requirement TP1710KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP1710IX SEG Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. Problem TP1740DR SEUK Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1750CC SEG Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Added Bates Numberring feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16AOSB SEUK Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Fix From: <sphj@ghj.com> To Be: From: "ghjeone" <sphjp.com> To</sphjp.com></sphjp.com></sphjp.com></sphjp.com></sphjp.com></sphj@ghj.com>		Problem	TP1750OA	SEG	Allow compact PDF option in XOA-E API for ISV solutions.
Problem TP16C0JD SEIL Fixed an issue that the destination of Scan Widget was displayed as None after the Scan Widget was terminated abnormally. Requirement TP1710KL SEAS A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP1710JX SEG Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. Problem TP1740DR SEUK Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16A0SB SEUK Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Jam Count Rreset feature to the service mode. Added a Fixed an intermittent issue that partially damaged PDF file is generated by color scanning with compact PDF option.		Problem	-	DEV	
Requirement TP1710KL SEASA A new API was provided to hide buttons on the navigation bar of UI such as back/home button. Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP1710JX SEG Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Requirement TP1670QW SEA Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16AOSB SEUK Added a Jam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16COIQ SEA AS-Is: From: <sphj@ghj.com> To-Be: From: "ghjeong" <sphj@ghj.com> To-Be: From: "ghjeong" <sphj@ghj.com> To-Be: Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.</sphj@ghj.com></sphj@ghj.com></sphj@ghj.com>		Problem	TP177025	SEHK	Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by corrupted data.
Requirement TP1730AG SEPOL Remove destination email address in the PDF file generated from Scan to email. Problem TP1710JX SEG Fixed an issue where one of continuous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder Problem TP1740DR SEUK Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Problem TP1750CC SEG Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Requirement TP1670QW SEA Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16A0SB SEUK Added a Fam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16C0JQ SEA Added a Fam Count Rreset feature to the service mode. As-Is: From: <sghj@ghj.com> To-Be: From: "ghjeong" <sghj@ghj.com> To-Be: From: "ghjeong" <sghj@ghj.com> Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.</sghj@ghj.com></sghj@ghj.com></sghj@ghj.com>		Problem	TP16C0JD	SEIL	7 7 7
Problem TP1710JX SEG Fixed an issue where one of continous printing jobs was not printed intermittently due to problems while spooling data to HDD. Problem TP1670LC SEA Added a new settings which specifies a default folders of Box App. *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder Fixed an issue that sometimes a job was not canceled and remained cancelling state until rebooting. Froblem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Requirement TP1670QW SEA Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Added a Jam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16C0IQ SEA Populate recipient name in front of "From" email address at the Scan to email function. ex) As-Is: From: spip-agh-ghj.com To-Be: From: "ghjeong" spip-agh-ghj.com Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.		Requirement	TP1710KL	SEASA	A new API was provided to hide buttons on the navigation bar of UI such as back/home button.
Problem Privious Problem Privious Problem Prob		Requirement	TP1730AG	SEPOL	Remove destination email address in the PDF file generated from Scan to email.
Problem TP1670LC SEA *Box App > Action Overflow(3 dot button) > Box Settigns > Default Display Folder	V5.E6.04.02.	Problem	TP1710JX	SEG	* ** **
Problem TP1740DR SEUK Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs were not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Requirement TP1670QW SEA Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16A0SB SEUK Added a Jam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Populate recipient name in front of "From" email address at the Scan to email function. ex) As-Is: From: ssphj@ghj.com To-Be: From: "ghjeong" ssphj@ghj.com Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.		Problem	TP1670LC	SEA	
Problem TP1740DR SEUK not printed by Print & Delete function for all jobs. Problem TP1750CC SEG Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data. Requirement TP1670QW SEA Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16A0SB SEUK Added a Jam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Populate recipient name in front of "From" email address at the Scan to email function. ex) As-Is: From: <sghj@ghj.com> To-Be: From: "ghjeong" <sghj@ghj.com> Fix an intermittent issue that partially damaged PDF file is generated by color scanning with compact PDF option.</sghj@ghj.com></sghj@ghj.com>		Problem		DEV	, and the second
Requirement TP1670QW SEA Added Bates Numbering feature to the copy app. Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu Requirement TP16A0SB SEUK Added a Jam Count Rreset feature to the service mode. Added a reset button to Service Menu > Maintenance Counts > Jam Count menu Problem TP16C0JQ SEA Populate recipient name in front of "From" email address at the Scan to email function. ex) As-Is: From: <sghj@ghj.com> To-Be: From: "ghjeong" <sghj@ghj.com> Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with compact PDF option.</sghj@ghj.com></sghj@ghj.com>		Problem	TP1740DR	SEUK	not printed by Print & Delete function for all jobs.
Requirement TP1670QW SEA Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More > Stamp menu		Problem	TP1750CC	SEG	Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono data and color macro data.
Requirement TP16AOSB SEUK Added a reset button to Service Menu > Maintenance Counts > Jam Count menu		Requirement	TP1670QW	SEA	Prefix, Suffix, and Number of Digit (up to 9 digits) settings are added to the Copy > More >
Problem TP16C0JQ SEA ex) As-Is: From: <sghj@ghj.com> To-Be: From: "ghjeong" <sghj@ghj.com> Problem TP16C003 SEG Fix an intermittent issue that partially damaged PDF file is generated by color scanning with compact PDF option.</sghj@ghj.com></sghj@ghj.com>		Requirement	TP16A0SB	SEUK	
compact PDF option.		Problem	TP16C0JQ	SEA	ex) As-Is: From: <sghj@ghj.com></sghj@ghj.com>
Requirement TP16909R SEBN Supported a special character \\' in the LDAP search option.		Problem	TP16C003	SEG	
		Requirement	TP16909R	SEBN	Supported a special character \' in the LDAP search option.

]		ı	ı	
	Problem	TP16C0EG	SECH	Added a function to automatically fill user email address registered in the job account (JAC) in recipients when logging in and running Scan & Send App.
	Problem		DEV	Even an user changes filename format of Scan&Send > Scan Options > Filename, real date & time will be used if it still has Dates&Time format, such as DDMMYY. ex) As-Is: test_DDMMYY saved as "test_DDMMYY"
V5.E6.04.01. 042409				To-Be: test_DDMMYY will save as "test_100517"
(2017-05-08)	Problem	TP1710G8	SECA	Fixed an issue where the Fax Reception Mode was set to DRPD and the ring pattern was memorized but it disappeared when the power was off and on.
	Problem	TP1710MR	SEA	Switch to fax sending job by deleting email address when entering fax numbers if email was already put as a recipient at the Scan & Send app.
	Problem	TP1720G8	SEG	Fixed an issue that remaining error handling videos were not displayed when one of the simultaneous error handling videos was closed.
	Problem		DEV	Fixed the black and white scan counts to be increased for scanning job with setting the color mode to the mono.
	Problem		DEV	Fixed not to print when user quota was exceeded while copying and printing simultaneously.
	Requirement	TP1660L0	SEUK	Added a function to select and take address directory from LDAP.
	Problem	TP1730EW	SEG	Fixed to select an item from LDAP result when Server tab is set as default at Scan & Send app's address directory function.
	Problem	TP1710GG	SEBN	Fixed an issue that when a PDF document created by a specific PDF generation tool was printed directly from USB, the output of the character spacing widened or an error occurred so that the output was not printed.
	Problem		SQA(HQ)	Improve double-sided printing speed of Executive paper size.
	Problem	TP1730KE	KOREA	Fix an error in PDF direct printing by abnormal font data included in the PDF file which is generated by specific PDF creator application.
	Problem	TP16C0KM	SEAU	Fixed an issue of filtering an e-mail as junk mail on Gmail server if the default message was used in the mail text and the e-mail recipient was Gmail during the scan to Email job.
	Problem		DEV	Fixed an issue of displaying devices with the same MAC address at Fleet Admin Pro's device list as wrong values were sent when collecting MAC address from Fleet Admin to SNMP.
		TP1710BP	SEA	Fixed an issue of initializing Job accounting setup info. created at FleetAdminPro when rebooting
	Problem	TP16707Q	SEDA	the device at SWS or FleetAdminPro.
		TP172037	SEASA	
	Problem		KOREA	Fixed an issue of intermittent disappearance of PC list by DB corruption when using Scan to PC.
V5.E6.04 (2017-03-24)	Problem		SEF	Fixed an issue of unworked SFE behaviors when applying SFE27, SFE54 setup at issued versions Issued Version: MX7 Vx.D6.29.03.XXXXXX ~ Vx.D6.30.04.XXXXXX MX4 Vx.D6.16.03.XXXXXXX ~ Vx.D6.17.04.XXXXXX M5370 V5.D6.15.03.XXXXXXX ~ V5.D6.16.04.XXXXXX M4580 V5.D6.14.03.XXXXXXX ~ V5.D6.15.04.XXXXXXX
	Problem		DEV	Fixed an issue of admin password change as default when enabling SFE 019 function at issued versions. Issued Version: MX7 Vx.D6.29.02.XXXXXX ~ Vx.D6.30.04.XXXXXX MX4 Vx.D6.16.02.XXXXXXX ~ Vx.D6.17.04.XXXXXX M5370 V5.D6.15.02.XXXXXX ~ V5.D6.16.04.XXXXXX M4580 V5.D6.14.02.XXXXXX ~ V5.D6.15.04.XXXXXX
	Problem	TP1690W6	SEF	Fixed several bouygues telecom issues.
	Problem	TP16B0CT	SEAU	Fixed the Searcheable PDF not being generated when a certain complex pattern is recognized
	Problem		KOREA	Fixed the error page not being printed abnormally in the solution environment's printing case.
	Problem	TP16B057	SEF	Fixed the Mono printer issue of job being canceled when the job was sent to color print driver with Application authentication on.
	Problem	TP16B027	KOREA	Fixed the issue of quota not being reset at times when the device goes into the sleep mode at the time of quota reset.
	Requirement	TP1630R0 VO-1506- 000610 VO-1507- 000139	SEA SECA SEG	Developed a new app for full build job support (The app will be released in the app center next Regualr FW release officially)
	Requirement	-	DEV	Developed a new Smart Scan app (The app will be released in the app center next Regualr FW release officially)
	Problem	-	DEV	Fixed the Schedule Image Overwrite automatically changing from on to off when powering the device on or off.
	Problem	 -	DEV	Improved screen transition speed between tabs on UI OOB app.

	Requirement	TP16402701	SEA	Modified the LDAP contact usernames to display either surname or given name.
	Requirement	TP1640FF07	SEA	Added a default contact selection feature between LDAP and local contacts in the Send app.
	Requirement	TP1650OK	SEA	Added SSO support to allow LDAP search using Kerberos ID/PW.
V5.D6.14.03. 120609	Requirement	TP165011	SEG	Added the Borderless printing feature. (SFE56)
(2016-12-08)	Requirement	TP1660JA	SEA	Added buckle adjustment feature in the service mode.
(2010-12-00)	Problem	TP16611L	SEUK	Fixed the intermittently changing home screen setting issue with wifi enabled.
	Problem	TP1670O8	SEA	Fixed the VNC connection issue when using a password with a certain character.
	Problem	TP168030	SEA	Fixed the intermittent booting issue after a FW update fail.
	Problem	TP1680K1	SEIL	Fixed the issue of VNC setting menu not showing correctly in Hebrew.
	Problem	TP1670IC	KOREA	Fixed remaining roller counts showing as negative numbers in the Counthru environment.
	Problem	-	KOREA	Fixed imaging unit or toner cartridge being recognized as uninstalled at times.
	Problem	TP169064	SENA	Fixed the printing error when using remote pull printing in the Printing Security Core solution.
	Piobleili		SENA	Trace the printing error when using remote pair printing in the Frinting Security core solution.
	Problem	TP1680JH TP1670W4	SEAU	Fixed fax reception stopping with an invalid caller ID coming through.
	Problem	-	DEV	Fixed fax reception issue with certain fax communication commands. - The fax communication command issue only occured in certain Jordan sites.
	Requirement	TP1690AQ	SECA	Added Letter/Legal MSO fax reception functionality.
		mp. (0.0) 5 (ara.	When selecting fixed the menu display revert Swedish or Hungarian language, the device storage
	Problem	TP1690MM	SENA	menu screen is reverted.
	Problem	TP1640A0	SEAU	When entering D or d after connecting external keyboard to USB, input value is not displayed properly and going back to the previous screen.
	Problem	TP16A020	SEUK	When pushing start button before From/To values of send app are prefilled, send job is not working from time to time.
	Problem	TP16A0FH	KOREA	SFE feature setting value changes to default from time to time.
	Requirement	SR-1508- 000118 VO-1508- 000350	SEA	The total user accounts increased from 500 to 2000.
	Fixed issue	TS-1512- 000029	SEAU	Intermittent job pending issue during scanning a large volume of media with compact PDF as an option was resolved.
	Requirement	TP1640K502	SEG	Printing on a number of paper types including Letterhead / Punched / Preprinted was improved
	Fixed issue	TP1660HG01	SEG	Modified mistranslation in German Label -> Etiketten
	Fixed issue	TP1660GU01	SEA	Intermittent print job stoppage when user processes complete after DSDF jam.
	Fixed issue	TP1660NE01	SESA	Resolved the issue of which reduced information, which was saved when program is generated, stays the same even if user changes the value later.
	Requirement	TP1650IT01	KOREA	Added a feature that can allow FAP monitoring of inactivation function of USB memory stick .
V5.D6.14.02.	Requirement	TP1650PP01	KOREA	Added an option that enables changing the priority order of multi-use paper tray during copy, based on tray priority regardless of paper type.
102513	Fixed issue	TP1660VG01	SEA	S5-3111 error not being displayed in error report was fixed.
(2016-10-31)	Fixed issue	TP16616201	SEDA	Fixed the issue of which the printer continues to print from a printable tray rather coming to a
	Fixed issue	TP16703Z01	SEA	Took out the description about features that are not applied to Help app.
	Fixed issue	TP16705401	KOREA	Resolved the issue of system user being logged on instead of an actual print user when the user logs out while printing with print security solution.
	Fixed issue	TP16701V01	SEA	Fixed the issue of +Me Box still running even when Box Application is disabled.
	Requirement	TP1630TE03	SEF	Added an option to maintain Jam animation until error is cleared.
	Fixed issue	TP16709701	SEBN	Secured a compatibility of PDF/A Scan file with ISO 19005-1.
	Requirement	TP1670DA01	KOREA	Added a feature to allow use or delete scan/ transmission destination.
	Requirement	TP1670PP01	KOREA	Added a function that aggregates usage data within a certain period of time selected by Counter App user.
	Fixed issue	TP16601Y	SEUK	Fixed user being automatically logged out while using MagStipe Readers login.
	Fixed issue	TP16502A	KOREA	Improved the issue of the system slowing down in DHCP mode without DHCP server connection.
	Fixed issue	TP1680J3	SECA	Fixed MP tray setting value is changed after Power on/off in case of envelop size.
	Fixed issue	TP16706H	SECH	Fixed slow printing issue when the set enables JAC Fleet Admin.
	Requirement	VO-1509- 000191 SR-1507- 000561	SEG SEF	Adding a feature to align the secure job list in LIFO and FIFO forms as preferred by user.
	Requirement	TP1650L8	SEDA- SIMPRES S	Adding a feature to turn on/off alarm for toner status when it's low.
	Requirement	SR-1507- 000568	SEG	Adding a selecting feature for a paper tray and a media type using a PJL command.

		Requirement	SR-1507- 000568	SEG	Adding a feature of sending state information only when the entire job is completed for any job linked to VPSX server.
		Requirement	SR-1506- 000840 VO-1410- 000185	SEBJ SEA Korea	Adding a PC scanning feature using a USB cable.
		Requirement	TS-1508- 000397	SEDA	Supporting UBS flash drive in NTFS format.
		Requirement	SR-1509- 000477	Korea	Adding a feature for making a document box invisible to users who login as SWS when admin disables the box.
		Requirement	VO-1511- 000153 SR-1601- 000115 VO-1511- 000059 TP1660B4 TP16610P	SECA Korea SEI	Adding a feature to allow users reboot a set at their desired time/cycle.
		Fixed issue	TS-1511- 000581 TS-1511- 000582 TS-1511- 000583	SEF	Improving the issue with intermittent failures when setting options for copy and/or authorization as Fleet Admin.
		Requirement	VO-1508- 000490	Korea	Disabling warning messages when the cover is open during platen scan.
		Requirement	VO-1509- 000398	SEUK	Adding a delete and a preview feature during box printing.
		Requirement	SR-1510- 000416	SELV	Modified to print a box-saved PRN file with Drive options that were applied when generating the PRN.
		Requirement	VO-1511- 000388	SEF	Adding a feature to display telephone numbers or names (as saved in the address book) in the Fax Sent Report.
	V5.D6.14.01. 081720 (2016-08-19)	Requirement	VO-1411- 000459 VO-1511- 000431	SENA SEF	Adding a Test button in the E-mail notification setting for an SMTP check.
		Requirement	SR-1512- 000207	SAPL	Adding a feature to reset a user's personal accounting information.
		Fixed issue	SR-1512- 000319	SENA	Improving authentication errors when an FTP password contains ":".
		Fixed issue	TS-1601- 000638	SEBN	Correcting the problem of test pattern not being printed in a service mode.
		Fixed issue	TP16500K	SEF	Improving the recognition failure of Skip blank feature during a low resolution scan (100dpi).
		Fixed issue	Q1603_0175	Korea	Improving the connection failure problem due to non-support for NOOP command in a certain
		Fixed issue	TP1630CO	SEBN	Adding additional paper types in the selection during Google cloud printing.
		Fixed issue	TP1630PW	Korea	Correcting intermittent failures of Color mode printing or color document being printed in mono
		Fixed issue	Q1603_0263	Korea	Correcting intermittent Power off malfunctions in NFC user interface.
		Fixed issue	TP1640AE	SEAU	Improving intermittent Kerberos authentication errors due to timing issue after powering on/off.
		Fixed issue	TP1640EO	SEBN	Improving poor Dutch translation.
		Fixed issue	TP1640F8	SEAU	Improving the issue of Multi destination emails not being sent when using a certain SMTP server.
		Requirement	SR-1509- 000006	Korea	Adding a feature to include PSTN line state information in Fax Diagnostic Report.
		Requirement	TP1650U601	Korea	Supporting special characters (<, >, ") for a password. (If usage environments is solution, then need to B2B driver and solution)
		Fixed issue	TP1630CY	Korea	Improving reading errors when using EPSoft card readers.
		Fixed issue	TP16500S	SEA	Improving print errors due to wrongly generated data during LPD/LPR print data processing.
		Fixed issue	TP1640IT	SSA	Improving the issue of completed secure print job remaining on the job list.
		Fixed issue	TP1630AU	SEA	When previewing PDF or TIFF images on Box App, the previewed image may have unexpected
		Fixed issue	TP1630FS TP1661SE	SEA SECA	During Scaning with compact PDF option, Set locks up at times.
		Fixed issue	TP16403C	SEAU	Fixing memory leackage issue according to repeated solution install/uninstall.
		Fixed issue	TP1640IZ	SEG	The poor German translation(StauWdrherste) will be changed.
		Requirement	SR-1508- 000346	SESA	Adding specific setting method through PJL command PCL font size, Tray1 paper size, Mp Tray paper size
		Fixed issue	TS-1603- 000018	SEUK	Correcting the problem of complex PDF document not being printed intermittently.

		TD1 ((0D I02		
	Requirement	TP1660DJ02 SR-1507-	SEG	Adding Numeric keypad for PIN code input in solution (API only).
	requirement	000265	SEAU	a (
	Requirement		SEUK	Adding APK installation method in the Fleet Admin Pro.
	Fixed issue	TP16613F	SEA	Fixing wrong IP address displaying on the notification screen in case of DHCP mode.
	Fixed issue	TP16502T	SEA	Fixing powerpoint abnormal output from MAC office 2016.
	Fixed issue	TP1640KG	SEG	Improving performance of 1-bit indexed color image document.
	Fixed issue	TP16706H	SECH	Fixing printing job pending issue according to authentication fail.
	Fixed issue	TP1650AD	Korea	Improving scanning speed when user sends many fax images.
	Fixed issue	TP1640DH	SEUK	Enhanced overall UI performance for a case where a device supports more than 501 external user
	Fixed issue	TP16500R	SEG	Fix inability to use '\$' character in Scan to SMB path.
	Fixed issue	TP165051	SME	Fix occasional inoperability on Copy Widget + buttons.
	Fixed issue	TP1660OX	KOREA	Fix printing jobs are held at times when burst job request is received.
	Fixed issue	TS-1601- 000563	SESG	Fixed a job pending issue during Scan to SMB using NetApp SMB server.
	Fixed issue	TP16303L03	SESG	Fixed an issue of user email not being prefilled in Send App during the Basic and Application Auth Mode while using Safecom solution.
	Fixed issue	TP16303L03	SESG	Fixed an issue of Safecom pull print application closing immediately after a user login. Enhanced the safecom login operations for time-dependent cases.
	Fixed issue	TS-1601- 000202	SENA	Enhanced user login performace (reduced the login time) for a case where hundreds of secure print jobs are stored in a device.
	Fixed issue	TP1630D701	SEI	Applied a scan authority checking process for a case where Dynamic Workflow is executed in the Application Auth mode before Send App launches after the device boots up.
	Fixed issue	TP1640XN	SEI	Enhanced copy widget performance for a case where a user tries to conduct a job immediately
	Fixed issue	TP1630TE	SEF	Disabled the PDF/A option for 600 dpi resolution in Send app.
V5.D6.14	Fixed issue	TP1630HK	SEBN	Fixed an issue of not cloning the authentication status in the admin setting for printing.
(5-July-2016)	Fixed issue	TS-1601- 000468	SEAU	Fixed an issue of scan images having a light background when a scan job is done with an "Auto Color: Color/Mono" option on.
	Fixed issue	TP1630CM	SEA	Fixed an issue of device card login not working sometimes in a sleep mode.
	Fixed issue	TS-1602- 000038	SEA	Enhanced print performance for duplex images (color/mono mixed images).
	Fixed issue	TS-1603- 000002	SEA	Added more animations for paper jam clearing guidance.
	Fixed issue	TS-1511- 000148	SEA	Made Scan to FTP compatible with Serv-U FTP server.
	Fixed issue	TS-1601- 000459	SAPL	Fixed an issue of color options not being able to be saved as default in Quick Copy in a Device Authentication mode.
	Fixed issue	TP16400T04	KOR	Fixed the login page sometimes displaying a white screen.
	Fixed issue	TP1630RG	KOR	Enhanced Copy widget printout performance to be as powerful as that of Copy App.
	Fixed issue	TP1640H0	KOR	Enhanced secure job cancel function to delete received data completely.
	Fixed issue	TP165022	KOR	Fixed Autologout not working sometimes in the Device UI.
	Requirement	-	-	Applied security compliance requirements from the Korean Government.
	Fixed issue	-	-	Fixed a 4K-Finisher jam error which occured when an OHP flim is used for copy.
	Fixed issue	-	-	Improved the management of the IP filtering feature and its default values.
	Fixed issue	N/A	KOREA	Print jobs are held at times when SecuThru (a secure printing software) is used.
	Fixed issue	N/A	SEI	Tray retard rollers cannot be seen in the service menu.
	Fixed issue	TS-1602- 000104	SEAU	GCP service fails as an expired key is not refreshed.
	Fixed issue	N/A	SEAU	The fax redials the number that was previously entered when dialing using the fax keypad under
	Fixed issue	N/A	SEAU	Send Job Cancel does not work at times right after starting Send Job when the Searcheable PDF
	Requirement	N/A	SEA	New US standard setting values were applied. (Default values for US models)
	Fixed issue	TS-1602- 000076	SEG	When making a searcheable PDF with a 300 dpi or lower resolution, scanned images are cropped and the text on the scans is hard to read in MS Word.
	Fixed issue	TS-1601- 000454	SEAU	The device locks up intermittently during scan when Job Progress Window is off.
	Fixed issue	TS-1601- 000564	SEUK/SE G	Send does not work at times when Skip Blank Page is on.
	Fixed issue	SR-1602- 000397	SEA	Scan to SMB fails if filename contains a space.
V5.D6.11	Fixed issue	TS-1512- 000456	SEBN	The number of copies cannot be selected when IPP printing in MAC OS.
(25-Mar- 2016)	Fixed issue	N/A	KOREA	Scan to PC shortcuts generated in a previous version (Vx.C6.xx) do not work after upgrading to Vx.D6.04.

	Fixed issue	SR-1601- 000384	SEI SEG	Fax confirmation reports are not printed to fit one page.
	Fixed issue	TP16307B	SEA	If the top bin of an inner finnisher is selected as the output tray, UI progress information is updated slowly. Also, the device slows down when handling 15 copies or more.
	Fixed issue	SR-1601- 000624	SEA	If Home Lock is enabled for all users, duplicate icons appear on the Home screen at times.
	Fixed issue	SR-1601- 000624	SEA	If a user changes the setting of Copy Customizer, the copy OOB setting also changes.
	Fixed issue	TS-1602- 000036	SEA	The Compact PDF option does not work when scanning with the Auto Color Mode on.
	Fixed issue	TS-1602- 000036	SEA	Scan Adjustment was modified to work according to the default paper size (A4 or Letter) of a country/region in which the machine will be used.
	Fixed issue	TS-1601- 000186	SEA	An output tray selected for incoming faxes changes back to the default tray after waking up in a power save mode.
	•	Add Func	•	Support function to create "Web page" shortcuts on the main UI.
		Add Func		Support Scan ACS Function
		Add Func		Added PIN only authentication mode.
		Add Func		Error code and description improved. Provides detailed information.
		Add Func		Job Promotion Activation Feature implemented.
		Add Func		If 'Staple Empty' error added. The User can select Continue or Hold.
		Add Func		Add Oficio size for Copy, Scan.
		Add Func		Scan to SMB with browsing.
		Add Func		New application to help customers to download and upgrade ROM manually/automatically using
		Add Func		Support Searchable PDF + PDF/A option.
		Add Func		Reduced the file size of searchable PDF (OCR PDF).
V5.D6.04		Add Func		SSL, TLS, None are supported for SMTP from SWS.
(08-Jan-2016)		Fix defect		The paper option is displayed Custom size on Apple device.
(00-3411-2010)	08-Jan-2010)			ID/PW values for Job Accounting are missing when user sets 'Preset' feature supplied by O/S.
				The machine stops intermittently when the Customer is using the copy Widget.
				If Application Authentication is enabled, previouly created short-cut does not work.
		Fix defect Fix defect		Value of counter app is wrong for specific period.
		Fix defect		Not able to send fax for more than 15 recipients.
		Fix defect		The output has wrong page order of booklet.
		Fix defect		You may see that LCD is black after wakeup by touch or wakeup by jobs.
		Fix defect		File can not be deleted from Box.
		Fix defect		Copy myprogram is not updated after edited and saved in home shortcut.
		Fix defect		DHCP renew does not work with P2 powersave.
		Fix defect		Booklet printing speed is improved.
V5.C6.11		Add func		Support Ext. Phone Full feature.
(22-Oct-2015)	Add func		Support China model.
(== ===================================	,	Add func.		Support Korean language file name on ScanToPC menu.
		Add func.		Supply security patch for Apk integrity.
		Fix defect		Machine rebooted very very rarely at receiving in case Machine is turned on by soft power on.
				Fix defect that user can't cancel current job sometimes.
		Fix defect Fix defect		Fix defect that user cancer current job sometimes. Fix defect of showing S5-3111 error on UI after sending print job while machine stays in sleep mode.
		Fix defect		Fix defect that machine will not wake up from UI sleep mode in spite of wake up event.
		Fix defect		Fix defect that the overwrite function doesn't work when import address book CSV file under GUI.
		E. 1.C.		
		Fix defect Fix defect		Fix wrong translation in Finnish.
				Fix Scan & send App to launch properly.
		Fix defect		Fix defect of not deleting job list in UI. Fix defect that XOA-Web login page issue. (showing home page instead of Xoa application page)
V5.C6.09		1 1A UCICCI		detect that 11011 1100 toght page issue, (showing nome page instead of Aoa application page)
(8-Sep-2015)		Add func.		Supporting the filename in send UI allowing to enter currencies .
	(0-3cp-2013)			Fix defect of not working copy widget.
				Add function to Send App of removing destinations after the Job is started.
		Fix defect		Fix defect that the Send App was crashed while launching the program with Auto start option, sometimes.
		Fix defect		Fix defect of rebooting by internal buffer overrunning.
		Fix defect	-	Fix defect of rebooting and broken image on 2-2 copy.
		Fix defect		Fix defect of broken image on duplex print (A5 SEF 2 - 2 book copy To MP Tray with Finisher).
••				

l .		End of the total and the control of
	Fix defect	Fix defect that when user adds manual route entry in routing table through SWS after reboot, user defined entry is lost and user is not able to set Wifi as default gateway.
	Add funa	* * *
	Add func. Fix defect	Add function of increased Font Size to 26 DP in Send application. Fix file name issue of Korean character in ScanToPC.
	Fix defect	Fix defect that traditional Chinese is not applied in Settings.
	Fix defect	Fix defect of stop 2-2 copy job
		Copy Save to box -> Store and print file name overwrite issue
		Scan to USB job is not happening after OHD Job.
		SWS set 400%, Copy show 400%. but output paper is 100%.
		App crash is observed if user taps on to the UI while image loading is on progress.
		Fix not for launching Send App. Program shortcut is seen after wakeup from sleep(log-out state).
V5.C6.06		PaperCut flicking issue.
(30-Jun-	Fix Defect	Fax Widget hanged and need POPO when continuous jobs are performed.
2015)		Fix defect of disapearing Short cut icon after POPO.
		Fix Fax Widget issue
		Fixed memory issues, it was crashing applications due to low memory.
		Change Watermark Icon.
		After reboot, all Send programs was not displayed on HOME.
		MFP was not discovered as Airprint device from MAC OS.
		For a Copy job, Original size detection is failed in case of ADF open.
		Add new Hebrew strings.
V5.C6.04	Ein D. C.	AMPV value is not correct with actual amount of usage.
(15-May- 2015)	Fix Defect	Box app close automatically if set Job Progress Window as Off and select a file and do print in Custom Paper size in Settings are not showed in Tray Confirmation pop-up window.
2013)		, , , , , , , , , , , , , , , , , , ,
		Scan to Email functionality improved.
		1. After Back up and Restore, Back up is not set(authorization. mode, application management).
		2. Fix a PCL6 error when print a A3 format by A4 size.
		3. Improve the delay to print a large sized PDF file.
		4. Wrong localized message for Communication Error string.
		5. LDAP issues and Auto log out issue.
		6. If user login before AA initialization, UI does not work with "Please wait" message.
		7. [Print Driver] Install/Print Performance Enhancement.
		S. Disable screen shot capture after restore the item is already set to disable but needs. Printing a job with Chinese name from USB does not work.
	Fix Defect	10. DNS does not work when IPv6 is enabled.
		11. Improve scan quality of original image with Watermark.
		12. Language combo is not appearing in EDC save properties window in Win XP environment.
		13. Change Custom sized paper type of MP tray to show in Tray Confirmation popup after
		14. Korean fonts from Safari AirPrint spool files are broken.
		15. Fix the custom paper size to save and show in Tray confirmation popup and Tray Settings.
		16. Add translation of Development Unit on SWS
		17. Support 'Scan to SMB V3' protocol on Mac OS 10.10
		18. Improve the printing time of A3 PDF file on MS Project.
		19. After power off using Power button on UI, FDI is not counted.
		20. Improve UI performance.
		All individual setups in the Android UI can save in a backup file. Add stamp position TOP_CENTER / BOTTOM_CENTER for Copy.
		Add stamp position TOP_CENTER / BOTTOM_CENTER for copy. Apply background image & guide text on FDI block screen.
		4. Display the status of Log-In.
		5. Add a confirmation prompt to exit service mode as well as for memory clear.
		6. Add 'host name' to pull down menu of home screen.
		7. Authentication for Entering "Apps" Menu.
		8. Add to show a warning against the status of HomeScreen Lock.
		9. Request supplies coverage data display on solutions (SyncThru, PrintFleet) by using SET MIB
		10. Add Fax Send Confirmation report.
		11. Add ID Send to box, but not to store in the USB device.
		12. Support Scandic letters when scan to email.
	Add Func.	13. Support Hebrew and Arbic font in 4th GUI.
		14. Support to select decreased image of first page on fax send report.
		15. Support SFE [032] - Line compensation for MS Excel.
		16. Add QR code that contains Device related data on Settings App. (Settings -> About System)
	1	17. Request to set Logout Confirmation popup to be enable or disable.
VE C4 02		18 Add a fasture to remove descriveted soon ID from III
V5.C6.03		18. Add a feature to remove deactivated scan ID from UI. 19. Request to sort Korean alphabetically for Scan To Shared Folder list
V5.C6.03 (17-Apr-2015)		18. Add a feature to remove deactivated scan ID from UI. 19. Request to sort Korean alphabetically for Scan To Shared Folder list 20. Support 'o' search filter in LDAP search and LDAP authentication.

II	Í	00 W
		22. Homepage customization of UI and remote distribution.
		23. Support Confidential Print icon as XOA solution. 24. Support PrinterOn solution by PAR.
		24. Support PrinterOn solution by PAR.25. Request for default user profile for users who logged in through 3rd party solution.
		Improve to be able to change the settings of the SMTP server through SWAS. Adjustable width on SmartSearch popular, when enter in Send to Email. The server through SWAS.
		Adjustable width on SmartSearch pop-up, when enter in Send to Email. Change the color for destination text in ScanWidget.
		Change the color for destination text in Scan widget. Paper weights(g) are added with each paper type in the window of tray confirmation popup.
		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
		5. Expand the number of characters in password for secure print.6. Change FaxWidget to be able to do another fax in processing.
		7. Change the method of showing Memory capacity (as Main+UI).
		8. Improve SWS Report feature view the printer report instead of printing to the printer.
		9. Change SPDS error code because are not same as the Device.
		10. Add new warning message not to turn off the device during FW upgrade.
		11. Change to notify NFC FW Upgrade to users.
		12. Support a local card reader of China (same as MX4).
		13. Support to enable Application Authentication for Web Print application.
	Change Spec.	14. Change to save more that 20 of Machine ID&Fax numbers in Fax Setting.
		15. Expand LDAP Search max results from 300 to 500.
		16. Change to be disable to access PDF option if other file format except of PDF is selected in
		17. Change to use UCS file as base table of Smart Color Manager.
		18. Admin password of many machines can be changable remotely at once.
		19. Disable manual input of email address on ScanToEmail.
		20. Add 480min as Power save time and disable Eco function.
		21. Implement Password validation to be handled in Send.
		22. Change ScanToFTP with configurable Communication Mode.
		23. Compatibility with HP UPD (Universal Printer Driver).
		24. Change Network PC FAX to support 500 reciepents.
		25. Support Early Warm Up for fast printing.
		26. Support "Address Book -> Import" feature for both 'Append' and 'Overwrite'.
		27. Support multilanguage for creating Box - file/folder.
		28. Change the previous destination to clear after system timeout or if reset is pressed, although
		29. [Print Driver] Support Custom Tray Mapping and Paper Based Watermark.
		30. Change the French translation from "Mon boite" to "MA BOITE".
		31. Remove the previous email address not to be remained in email address box to enter after 32. Change the German text from "Anwendungs mangement" to "Anwendungsmangement" in
	Delete Func.	Remove Online Registration from SWS > Maintenance > Links.
	Defete Fulic.	After continous fax jobs are completed, Job window for showing the progress does not closed.
		UI is pending or Firmware update is going slow intermittenly during booting.
		Wakeup failure from Power save mode intermittently.
	Fix Defect	4. OPC Install Date Writing failure.
V5.B6.21		5. Wrong date is printed on receive site when sending a Fax.
(6-Mar-2015)		6. Some ISV application does not started after rebooting machine.
		Separate Fax Send report from the common report.
	Change Spec.	2. Change UI Firmware to be compatible with eMMC of KingSton.
		3. Send usage counter is different from between Counter app and Usage counter information
V5.B6.14		
(22-Dec-	Fix Defect	1. UI Black screen error during booting abnormally.
2014)		
		Fix pending on fax receiving by pressing stop button.
		2. Fix send app crashing issue.
		Add the wholely delete button on Fax widget. Improve Scan to PC speed.
		5. Improve LDAP searching function.
		improve LDAP searching function. Fax printing on unidentified phone number.
	Fix Defect	7. Private folder ID can set up upto 64 byte.
		8. Improve SMB scan function.
		9. Modify Google Cloud Printing resister.
		10. Improve line handling performance.
		11. Fix Store and Print issue.
		12. Fix Stop button issue on MP Tray.
		1. Add the button to delete task at once.
		2. Improve LDAP searching function.
		3. Support DFS (Distributed File System) option on SWS. 4. Number keyroid defaulted when PIN code log in
		Number keypad defaulted when PIN code log-in. Add saving option the created local user to address book.
		Add Saving option the created local user to address book. Add Scan Masking Area Adjuistment on Tech Mode.
		7. Add Send tap destination Adjustment.
		8. Support A5 size LEF printing.
		9. Add delete option for default application.
	ı	

1	1	10. Add function for playing video clip on USB memory.
		11. Add the function of WiFi / Active NFC.
		12. Add Myfax option in +Me setting.
	Add Func.	13. Add sharing function on Box App.
		14. Add Index scrolling in address book.
		15. Support Scan to Me.
		16. Add VNC fuction (Virtual Network Computing).
V5.B6.10		17. Add Sharing function Send APP to other APPS.
(14-Nov-		18. Support prefix dial on Fax widget.
2014)		19. Add Wi-Fi icon when connected.
		20. Add duplex printing option when printing in USB.
		21. Add option of Web print APP disable.
		22. Add Haptic function to all menu.
		23. Add Web address function of auto complet, progress bar, delete at once.
		24. Add the button to delete task at once.
		Delete initial page on Copy shortcut.
		Initialize the copy option when click the Interupt during copying.
		3. Auto paper detection when using the scan widget.
		4. Copy APP's preview can change to Number keypad.
		5. Improve UX usability.
		6. Improve the searching usability of LDAP address book.
		7. Automatically destinate to USB when insert USB memory.
		8. Add extra stamp position.
		9. Enlarge the size of number on Fax widget.
	Change Spec.	10. Home Screen Setting authorized by admin, not user.
	Change spec.	11. Always wake up the Panel during video clip play.
		12. Remain recipient after Scan and Send execute.
		13. Add enter the copies number function in Copy widget.
		14. Shows defaultly number keypad in Fax widget.
		15. Create single PDF/TIFF files by scan.
		16. Display lock image on Secure PDF.
		17. Admin has authorize to delete the private folder.
		18. Default color setting of Copy widget is syncronized with Copy APP.
		19. Email notification of Counter Report includes essitial contents.
		20. Reduce Scan noise.
	Delete Func.	1. Remove user information from Logs.
	Defette Pulic.	2. Remove "Ready to Copy" string placed on right bottom of Panel.