

Firmware Release Note

| | |
|----------------------------|--------------------------|
| Model: X4300 Series | Date: 31-May-2021 |
|----------------------------|--------------------------|

V6.J6.00 FW addresses 1 issue.

- Major Change

- 1) Added support for backside CIS from multiple vendor.

Please upgrade the FW with V6.I6.00 if any one of the problems below need to be resolved.

| Version | Category | TSP ID | Division | Change Description |
|---------------------------------|-------------|--------|----------|--|
| V6.J6.00 (2021-05-31) | Requirement | | KOREA | Added support for backside CIS from multiple vendor. |

Software Component Versions

| | |
|-------------------------|----------------------------|
| System Firmware | V6.J6.00 |
| Main FW Version | V11.01.16.00_04-01-2021 |
| XOA Web | 1.4.33 |
| UP | 1.17.34_(20171218171009) |
| Engine Firmware | V3.00.42 |
| File System Version | FS_V14.03.06.21.13 |
| SCB(Scan,Fax) Version | V3.00.05.06 |
| Boot Rom Version | V13.10.00.00.94-07-10-2020 |
| UI Firmware | V5.18.50.13.00_20062913 |
| ADF Firmware | 00.03.40 |
| Tray1 | V3.00.42 |
| Tray2 | V3.00.42 |
| Tray3 | V4.01.04 |
| Tray4 | V4.01.04 |
| finisher(Inner) Version | V01.56 |
| finisher(3K) Version | V02.67 |
| Booklet Version | V02.33 |
| Hole Punch Version | V04.06 |
| PCL5CE | PCL5E_V8.22_170906 |
| PCLXL | PCL6C_V11.00.90 |
| PS/PDF/XPS | V6.21.01.62.02.03_170415 |

Image Quality tables

| | |
|-----------|------------|
| EP | V1.18 |
| Fuser | V1.95 |
| Toner | V1.00 |
| TR | V0.53 |
| Print CMS | V8.1.0705K |
| Copy CMS | V8.2.1117K |
| Scan CMS | V1.83 |
| Print IEM | V1.1 |
| Copy IEM | V3.13 |

Update dependency

| |
|--|
| - If the previous firmware version is lower than V6.C6.04, please install Service Pack first, which is needed to prevent delay in upgrading all UI firmware. |
| - If System FW version is prior to V6.C6.12 (Engine version V2.00.22), then update the FW with the following procedures: |
| 1) Disconnect 2K, 3K-Finisher |
| 2) Upgrade FW |
| 3) Connect 2K, 3K-Finisher |
| 4) Upgrade FW again |
| 5) Confirm 2K, 3K-Finisher version |

Solution Compatibility Table

(X4300 : V6.J6.00)

| Category | Solution Name | Solution Version | V6.J6.00 | Verified F/W Version |
|----------|----------------------|------------------|----------|----------------------|
| BCPS | CloudConnectorCore | 2.50.008 | ○ | V6.H6.00 |
| | DocumentWorkflowCore | 2.50.007 | ○ | V6.H6.00 |
| | PrintingSecurityCore | 2.50.009 | ○ | V6.H6.00 |
| | SecureLoginCore | 2.50.006 | ○ | V6.H6.00 |

| | | | | |
|------------------|------------------------------|---|----------|--------------------|
| | UsageTrackerCore | 2.50.007 | ○ | V6.H6.00 |
| | XOA-WEB Enabler | 2.00.003 | ○ | V6.D6.16 |
| ISV-XOA-E | Autostore | 1.0.0 (Server : 7.00.3.0 (DRS:7.0.1.16, APD:7.0.3.26)) | ○ | V6.E6.02.02.060911 |
| | Drivve Image | 1.5.43 (Server : 5.1.546) | ○ | V6.C6.04 |
| | Drivve Print | 1.1.30 (Server : 3.1.100) | ○ | V6.C6.04 |
| | Equitrac | 1.1.0.135 (Server : 5.2.21.8778) | ○ | V6.D6.16.03.120609 |
| | Geniusbytes MyMFP | 2.19.6.2 (Server : 2.19.3) | ○ | V6.G6.02.02.050715 |
| | NDDigital n-Access | 2.1.3 (Server : NDDigital n-Billing 4.9) | ○ | V6.D6.06 |
| | NDDigital n-Collector | 2.2.4 (Server : NDDigital n-Billing 4.9) | ○ | V6.D6.06 |
| | NDDigital n-Releaser | 2.1.4 (Server : NDDigital n-Billing 4.9) | ○ | V6.D6.06 |
| | Omtool AccuRoute | 1.0.0.689 (Server : 2013(Build 5)) | ○ | V6.D6.06 |
| | PaperCut | 1.1.0 (Server : 16.4 (build 38954)) | ○ | V6.F6.01 |
| | PrintFleet Cloud Embedded DC | 1.1.249 (Server : 3.6) | ○ | V6.E6.02.02.060911 |
| | Ringdale FollowMe | 1.1.2.9 (Server : 6.1.0.103) | ○ | V6.D6.06 |
| | SafeCom | 010.24.23 (Server : 10.520.10.35) | ○ | V6.F6.04.03.101119 |
| | SafeQ Embedded Terminal | 1.0.0 (Server : C.0.18.002) | ○ | V6.D6.16.03.120609 |
| | Scanner Vision | 1.0.6 (Server : 6.2.0.270) | ○ | V6.D6.06 |
| | Scanshare Essentials | 1.5.15.167 (Server : 4.0.5) | ○ | V6.D6.06 |
| | Ubiquitech Easy & VDMS | 1.5.3-rel3 (Server : 5.0.0-rel [ca91b]) | ○ | V6.D6.16.03.120609 |
| | e-Paper Sentinel | 5.0.7 | ○ | V6.D6.06 |
| Prism ScanPathTM | 1.0.49 (Server : 2.5.0.29) | ○ | V6.C6.04 | |
| SmartUX | Nuance unified client | 1.0.0.606 (Server : 5.7.28.6490(CAS:5.7.28.6490, APD : 7.0.4.0)) | ○ | V6.H6.00 |
| PrinterOn | PrinterOn Branded Agent | 2.03.003 | ○ | V6.F6.04.03.101119 |

◎ A solution has been verified and MUST be compatible with the releasing F/W version.

○ Previously the supported solutions have been tested and verified with the version specified in the "Verified F/W version" row in the table.
The required test has been conducted on this FW version to ensure the backward compatibility with "Verified F/W version".

FW Release History

| Version | Category | TSP ID | Division | Change Description |
|--|-------------|----------------------|----------|---|
| V6.I6.00 (2021-03-30) | Problem | | KOREA | Fixed, the device lock up issue for Gigabit supported Cisco Switch. |
| | Problem | | KOREA | Fixed, ITB T1 ENGAGE POSITION ERROR A1-4310. |
| V6.H6.00 (2019-12-27) | Problem | | KOREA | Removed the functionality to print the barcode. |
| | Problem | | KOREA | Fixed, inner finisher folding and not stapling the last page when printing odd number of copies issue. |
| | Problem | | KOREA | For Gov models, the A4 Demo page is changed to add more information. |
| | Problem | | KOREA | Fixed, the SNMP OID status for HCF tray to display it on the panel. |
| V6.G6.02.02.05 0715 (2019-01-30) | Problem | | KOREA | Fixed, XSS weak point of Samsung models. |
| | Problem | | KOREA | Fixed, slow UI and slow copy feature. |
| | Problem | | KOREA | Fixed, IPv6 manual address for fdxx as prefix. |
| | Problem | | KOREA | Fixed, S5-3116 if no hardware failure. |
| | Problem | | KOREA | Implementation of new requirement to enhance the SWS security. |
| | Problem | | KOREA | Added more flexible configuration to control device quota. |
| | Problem | | KOREA | Fixed the IDCOPY parameter getting reversed while submitting of job. |
| | Problem | | KOREA | Fixed, to print all documents in queue from BCPS when documents come from MacOS. |
| | Problem | | KOREA | Fixed, the fax not working while in power save mode. |
| | Problem | | KOREA | Fixed, conflict between Front Back in Cover and Fold Staple in Booklet. |
| | Problem | | KOREA | Fixed the issue of device going to home screen after login using GeniusMFP solution. |
| | Problem | | KOREA | Fixed, Manual Reset of device quota reset policy. |
| V6.G6.02 (2019-01-30) | Problem | | KOREA | Fixed the UI-2316 Abnormal ADC error (Fuser Thermistor Error and Low heat error) |
| | Problem | | KOREA | New translation of thai language is added for wrap jam error. |
| | Problem | | KOREA | Fixed the UI slowness issue which use to happen after adding more widgets at home and machine was not rebooted for 2 to 3 days. |
| V6.F6.04.03.10 1119 (2018-11-01) | Problem | | KOREA | Fixed the issue that image log not sent to Printing Security Solution Server when fax images received through Line2 |
| | Problem | | KOREA | Improved Fusing mechanism for Fuser wrap JAM |
| | Problem | | DEV | Fixed the issue of WSD Print installation with Win10 (1703/1709/1803) |
| | Problem | | DEV | Fixed the Google Address Book stay signin issue and showing previous user contacts |
| | Problem | SIE174695 | EMEA | Fixed the issue of Box app Authentication |
| V6.F6.04.02.07 2419 (2018-08-01) | Problem | SIP68753 TP174000 | EMEA | S1-2452 Error issue was fixed by improving the DB recovery logic |
| | Problem | | DEV | When SNMP Community Web Service is called via HPSM application to add/edit/delete the |
| | Problem | SIP68582 | AMS | Fixed SMB 2/3 job failed issue due to excessive permissions requested |
| | Requirement | | DEV | SNI(Server Name Indication) is added by new requirement for Google Cloud Print servers when SSL enabled. |

| | | | | |
|--|-------------|------------------------|---|--|
| (2018-05-04) | Requirement | | DEV | New feature implementation for configurable 'SSL/TLS' protocols and ciphers option. Security level configuration can be done according to user requirement from SWS. |
| | Problem | SIE173360 | EMEA | Fixed booklet fold & staple option is not working when printing muple copies from stored |
| | Problem | | SEU | The Punch option doesn't take effect after changed it from 2Punch to 4Punch under Box- |
| V6.F6.04.01.04 1619 (2018-05-04) | Problem | TP1790KD | SEAU | 'Error 403' caused when connecting to Google Addressbook due to Google policy changes is |
| | Problem | - | DEV | The intermittent stoppage caused when creating Hibernation Image when https is enabled is |
| | Problem | - | DEV | Inaccurate range value associated with Scan background density from Nuance Unified client |
| | Problem | TP17A06W | SEA | The issue that file stored at Box App is not intermittently deleted at the device where HDD |
| | Problem | SIP65410 | SEG | The issue that Ext.Phone setting in service mode revert back to initialized value when dual |
| | Problem | - | SEBN | Login speed has improved when using Nuance Unified client. |
| | Problem | SIP65701 | SEG | The issue that certificate related setting value is reset as default after changed F/W version |
| | Problem | SIP64544 | SEAU | The issue that fuser detection fails due to intermittent timing in case that a user sends a job |
| | Problem | SIE154757 SIE156425 | SAU | The issue that email is not delivered under ScantoEmail in case that special characters(ex)(',') are included in sender's user name is fixed. |
| | Requirement | SIE157066 | EMEA | New certificate of Google Cloud server is applied. |
| V6.F6.04 (2018-02-12) | Problem | - | SEG | Copy sharpness value change failure on FAP is fixed. |
| | Problem | - | EMEA | Special characters except for '<' and '>' are now allowed as LDAP server access password. |
| V6.F6.01 (2017-10-27) | Problem | - | KOR | Change to define start and end time when enabling performance optimization feature. |
| | Problem | - | SEG | Fixed an issue of unintended color being printed because of wrong processing of 1x1 size |
| | Problem | - | KOR | Fixed an issue of black text printed as white in specific application for color printers. |
| | Problem | TP17801L | SEBN | Fixed an issue of the reset database menu being displayed at booting phase by intermittent |
| | Problem | TP1780HF | SEUK | Fixed an issue of MIB info being displayed as 0 when inquiring the forward roller MIB info |
| V6.E6.02.04.09 0410 (2017-09-20) | Requirement | - | SEF | LUI default screen is changed to Kiosk home screen when FDI and Smart Printing Kiosk app |
| | Problem | TP1720J901 | KOR | Allow Korean characters in the Scan to SMB path. |
| | Problem | TP173078 | SEUK | 1 sheet booklet and folding printing job, which can have 1~4 pages original document, is |
| | Problem | - | DEV | Fixed an issue of iterated login and logout when performing NFC authentication on device, |
| | Problem | TP1740C3 | SEA | Fixed an issue of slow booting or WIFI disconnection when power cycled by soft power |
| | Problem | TP174000 | SEUK | Improve DB(Database) error recovery routine for damaged record only instead of DB |
| | Problem | TP1750JO | SEAU | Fixed an issue of a scan job being stopped when adding a document while the last document |
| | Problem | TP176005 | SEI | Fixed an issue of the memory clear button in the service menu not being activated after |
| | Problem | TP17500A | SEG | Allow compact PDF option in XOA-E API for ISV solutions. |
| | Requirement | - | DEV | The Blue Angel 2017 ready. |
| V6.E6.02.02.06 0911 (2017-06-20) | Problem | TP17704P | SEG | Fixed an issue of WIFI direct not being connected when WIFI/Bluetooth module(SL- |
| | Problem | TP177025 | SEHK | Fixed an issue of a Fax Rx job pending when all received pages can not be decoded by |
| | Problem | TP16C0JD | SEIL | Fixed an issue that the destination of Scan Widget was displayed as None after the Scan |
| | Requirement | TP1710KL | SEASA | A new API was provided to hide buttons on the navigation bar of UI such as back/home |
| | Problem | TP1710HT | SEBN | Fixed a defected printing image at the bottom area when the job was printed from DCF with |
| | Requirement | TP1730AG | SEPOL | Remove destination email address in the PDF file generated from Scan to email. |
| | Problem | MKT | SEA | Fixed a problem where the Hole punch menu was not visible in the Copy App when Hole |
| | Problem | TP17309T | SEA | Fixed an issue where color copier with booklet finisher got outbin full while printing B/W |
| | Problem | TP1710JX | SEG | Fixed an issue where one of continous printing jobs was not printed intermittently due to |
| | Problem | TP1670LC | SEA | Added a new settings which specifies a default folders of Box App. |
| | Problem | - | DEV | Fixed an issue that sometimes a job was not canceled and remained cancelling state until |
| | Problem | TP1740DR | SEUK | Fixed an issue that when a large number of print jobs were saved in the Box, some of jobs |
| | Problem | TP17508F | SEG | Fixed an issue that even "booklet folding position offset" settings for A3 or Ledger(11"x17") |
| | Problem | TP1750CC | SEG | Fixed an issue of stripped patterns on the part of image of PCL5 job which consists of mono |
| | Problem | TP1750I4 | SEA | Fixed an issue where the finishing option was cleared to default when printing a saved |
| Problem | TP17600R | SEG | Fixed an issue where finishing option is cleared to default when the job was rescheduled by | |
| V6.E6.02.01.04 2409 (2017-05-08) | Requirement | TP1670QW | SEA | Added Bates Numbering feature to the copy app. |
| | Problem | TP16802X | SEA | Fixed an issue of setting value reset when program was executed after setting a booklet |
| | Requirement | TP16A0SB | SEUK | Added a Jam Count Rreset feature to the service mode. |
| | Problem | TP1680KD | SEG | Fixed an issue where the separator page was stapled together with the original printout when |
| | Problem | TP16C0JQ | SEA | Populate recipient name in front of "From" email address at the Scan to email function. |
| | Problem | TP16C003 | SEG | Fix an intermittent issue that partialy damaged PDF file is generated by color scanning with |
| | Problem | TP171017 | SEA | Fixed not to staple every single page for multiple printing of one page. |
| | Requirement | TP16909R | SEBN | Supported a special character '\ in the LDAP search option. |
| | Problem | TP16C0EG | SECH | Added a function to automatically fill user email address registered in the job account (JAC) |
| | Problem | - | DEV | Even an user changes filename format of Scan&Send > Scan Options > Filename, real date |
| | Problem | TP1710MR | SEA | Switch to fax sending job by deleting email address when entering fax numbers if email was |
| | Problem | TP1720G8 | SEG | Fixed an issue that remaining error handling videos were not displayed when one of the |
| | Problem | - | DEV | Fixed the black and white scan counts to be increased for scanning job with setting the color |
| | Problem | - | DEV | Fixed not to print when user quota was exceeded while copying and printing simultaneously. |
| | Requirement | TP1660L0 | SEUK | Added a function to select and take address directory from LDAP. |
| Problem | TP1730EW | SEG | Fixed to select an item from LDAP result when Server tab is set as default at Scan & Send | |
| Problem | TP1710GG | SEBN | Fixed an issue that when a PDF document created by a specific PDF generation tool was | |
| Problem | - | DEV | Improve double-sided printing speed of Executive paper size. | |
| Problem | TP1730KE | KOREA | Fix an error in PDF direct printing by abnormal font data included in the PDF file which is | |

| | | | | |
|--|-------------|--|--|---|
| V6.E6.02 (2017-03-24) | Problem | TP16C0KM | SEAU | Fixed an issue of filtering an e-mail as junk mail on Gmail server if the default message was |
| | Problem | | DEV | Fixed an issue of displaying devices with the same MAC address at Fleet Admin Pro's device |
| | Problem | TP1710BP TP16707Q TP172037 | SEA SEDA SEASA | Fixed an issue of initializing Job accounting setup info. created at FleetAdminPro when rebooting the device at SWS or FleetAdminPro. |
| | Problem | | KOREA | Fixed an issue of intermittent disappearance of PC list by DB corruption when using Scan to |
| | Problem | | SEF | Fixed an issue of unworked SFE behaviors when applying SFE27, SFE54 setup at issued |
| | Problem | TP1720A7 | SEPOL | Fixed an issue where a duplex-scanned document was crumpled in a Z shape in paper exit at |
| | Problem | | DEV | Fixed an issue of admin password change as default when enabling SFE 019 function at |
| V6.D6.17.04.01 1308 (2017-01-23) | Problem | TP1670DJ | SEA | Fix an issue that destination information disappears at program execution after address book |
| | Problem | TP1670LQ | SEA | Allow mixed size to be default for original size value in the Copy / Send App, and keep the |
| | Requirement | | SEUK | Fax paper source tray setting is added to SWS. |
| | Problem | TP1670UW | SEI | Add "[,], ^" to the folder name input function at Scan to SMB feature. |
| | Problem | TP1680HV | SENA | Add Umlaut charset to the folder name input function at Scan to SMB feature. |
| | Problem | TP1690AR | SEA | Fix issues at Air print |
| | Problem | - | DEV | Improve G3 fax transmission / reception quality and retry job protocol in VoIP environment. |
| | Problem | TP16A0B5 | SEA | Fix a problem where the machine reboots when using small paper that is not supported by |
| | Problem | TP16B017 | SEG | Use a temporary file name while scanning and saving the file, and rename it after the saving is |
| | Problem | TP16B0I7 | SECA | Fix an issue where JAC enable / disable do not work by job type via Fleet Admin Pro. |
| | Problem | TP16B0LX | SEPOL | Fix a problem that causes the device to freeze when the scanned image is skewed from the |
| | Problem | TP16B0ON | SEI | Fix a problem that cause performance degradation when using counter widget |
| | Problem | TP16B0SM | SEF | Fix an issue where the total sent page is incorrectly displayed in the fax sent report when |
| | Problem | TP1690PR | SEG | Fix machine stop when setting the Compact PDF option and changing color setting to Mono |
| | Problem | TP16A0OQ | SEA | Correct the problem that certain SFE functions are turned off after HDD recovery. |
| | Requirement | - | DEV | Add HDD defect check function in HDD recovery mode screen. |
| | Requirement | - | KOREA | Improve fax widget button size and space between buttons for user convenience. |
| | Problem | TP1670VH | SEG | Fix the problem where scan data transfer is slowed down for a sync problem when there are |
| | Requirement | - | SEVT | Support Vietnamese at UI. |
| | Problem | Q1612_0069 | KOREA | Correct the problem where the abnormally large wrong value of impression counter is |
| Problem | - | DEV | Fix a false alarm which misunderstands that IP conflict occurs from ARP protocol cache | |
| Problem | - | DEV | Fix the device stop when setting double-sided, 400% enlarge option in copy job. | |
| Problem | Q1611_0054 | KOREA | Fix the problem where the device is slowed down when ACR and TRC jobs are improperly | |
| V6.D6.16.03.12 0609 (2016-10-31) | Problem | TP1690W6 | SEF | Fixed several bouygues telecom issues. |
| | Problem | TP16B0CT | SEAU | Fixed the Searchable PDF not being generated when a certain complex pattern is |
| | Problem | TP16A0NJ | SEBN | Fixed the FR carriage hitting the frame when scanning 432mm media on the platten. |
| | Problem | | KOREA | Fixed the error page not being printed abnormally in the solution environment's printing case. |
| | Problem | TP16B027 | KOREA | Fixed the issue of quota not being reset at times when the device goes into the sleep mode at |
| | Requirement | TP1630R0 VO-1506- 000610 VO-1507- 000139 | SEA SECA SEG | Developed a new app for full build job support (The app will be released in the app center next Regualr FW release officially). |
| | Requirement | - | DEV | Developed a new Smart Scan app (The app will be released in the app center next Regualr FW release officially). |
| | Problem | - | DEV | Fixed the Schedule Image Overwrite automatically changing from on to off when powering |
| | Requirement | - | DEV | Applied a new CMS function for print image quality improvement. |
| | Problem | - | DEV | Improved screen transition speed between tabs on UI OOB app. |
| | Requirement | TP164027 | SEA | Modified the LDAP contact usernames to display either surname or given name. |
| | Requirement | TP1640FF | SEA | Added a default contact selection feature between LDAP and local contacts in the Send app |
| | Requirement | TP1650OK | SEA | Added SSO support to allow LDAP search using Kerberos ID/PW. |
| | Requirement | TP165011 | SEG | Added the Borderless printing feature. (SFE56) |
| | Requirement | TP1660JA | SEA | Added buckle adjustment feature in the service mode. |
| | Problem | TP16611L | SEUK | Fixed the intermittently changing home screen setting issue with wifi enabled. |
| | Problem | TP1670O8 | SEA | Fixed the VNC connection issue when using a password with a certain character. |
| | Problem | TP168030 | SEA | Fixed the intermittent booting issue after a FW update fail. |
| | Problem | TP1680K1 | SEIL | Fixed the issue of VNC setting menu not showing correctly in Hebrew. |
| | Problem | TP1670IC | KOREA | Fixed remaining roller counts showing as negative numbers in the Counthru environment. |
| | Problem | TP168100 | SENA | Fixed Swedish punch not working in a print job. |
| | Problem | - | KOREA | Fixed imaging unit or toner cartridge being recognized as uninstalled at times. |
| | Problem | TP1680P0 | SEA | Fixed job stopping at times when printing using a driver with a 3-hole punch option selected. |
| | Problem | TP169064 | SENA | Fixed the printing error when using remote print printing in the printing security Core solution. |
| | Problem | TP1680JH TP1670W4 | SEAU | Fixed fax reception stopping with an invalid caller ID coming through. |
| | Requirement | TP1690AQ | SECA | Added Letter/Legal MSO fax reception functionality. |
| | Problem | TP1690MM | SENA | When selecting fixed the menu display revert Swedish or Hungarian language, the device storage menu screen is reverted. |
| Problem | TP1640AO | SEAU | When entering D or d after connecting external keyboard to USB, input value is not displayed properly and going back to the previous screen. | |

| | | | | |
|--|-------------|--|--|--|
| | Problem | TP16A020 | SEUK | When pushing start button before From/To values of send app are prefilled, send job is not working from time to time. |
| | Problem | TP16A0FH | KOREA | SFE feature setting value changes to default from time to time. |
| V6.D6.16.02.10 2513 (2016-10-31) | Requirement | SR-1508-000118 VO-1508-000350 | SEA | The total user accounts increased from 500 to 2000. |
| | Fixed issue | TS-1512-000029 | SEAU | Intermittent job pending issue during scanning a large volume of media with compact PDF as an option was resolved. |
| | Requirement | TP1640K502 | SEG | Printing on a number of paper types including Letterhead / Punched / Preprinted was improved |
| | Fixed issue | TP16500E02 | KOREA | Corrected job pending issue during duplex V folding in MAC OS. |
| | Fixed issue | TP1660HG01 | SEG | Modified mistranslation in German |
| | Fixed issue | TP1650R801 | SEUK | Resolved the issue of which the print job is always printed on A3 regardless of what user |
| | Fixed issue | TP1660GU01 | SEA | Intermittent print job stoppage when user processes complete after DSDf jam. |
| | Fixed issue | TP1660NE01 | SESA | Resolved the issue of which reduced information, which was saved when program is |
| | Requirement | TP1650IT01 | KOREA | Added a feature that can allow FAP monitoring of inactivation function of USB memory stick. |
| | Requirement | TP1650PP01 | KOREA | Added an option that enables changing the priority order of multi-use paper tray during copy, based on tray priority regardless of paper type. |
| | Fixed issue | TP1660VG01 | SEA | S5-3111 error not being displayed in error report was fixed. |
| | Fixed issue | TP16616201 | SEDA | Fixed the issue of which the printer continues to print from a printable tray rather coming to |
| | Fixed issue | TP16703Z01 | SEA | Took out the description about features that are not applied to Help app. |
| | Fixed issue | TP16705401 | KOREA | Resolved the issue of system user being logged on instead of an actual print user when the |
| | Fixed issue | TP16701V01 | SEA | Fixed the issue of +Me Box still running even when Box Application is disabled. |
| | Requirement | TP1630TE03 | SEF | Added an option to maintain Jam animation until error is cleared. |
| | Fixed issue | TP16709701 | SEBN | Secured a compatibility of PDF/A Scan file with ISO 19005-1. |
| | Requirement | TP1670DA01 | KOREA | Added a feature to allow use or delete scan/ transmission destination. |
| | Requirement | TP1670PP01 | KOREA | Added a function that aggregates usage data within a certain period of time selected by Counter App user. |
| | Fixed issue | TP16601Y | SEUK | Fixed user being automatically logged out while using MagStipe Readers login. |
| Fixed issue | TP16502A | KOREA | Improved the issue of the system slowing down in DHCP mode without DHCP server | |
| Fixed issue | TP1680J3 | SECA | Fixed MP tray setting value is changed after Power on/off in case of envelop size. | |
| Fixed issue | TP16706H | SECH | Fixed slow printing issue when the set enables JAC Fleet Admin. | |
| Fixed issue | TP16704Z01 | SEA | Fixed intermittent jam when legal media is loaded in Tray 4. | |
| | Requirement | VO-1509-000191 SR-1507-000561 | SEG SEF | Adding a feature to align the secure job list in LIFO and FIFO forms as preferred by user. |
| | Requirement | TP1650L8 | SEDA- SIMPRESS | Adding a feature to turn on/off alarm for toner status when it's low. |
| | Requirement | SR-1507-000568 | SEG | Adding a selecting feature for a paper tray and a media type using a PjL command. |
| | Requirement | SR-1507-000568 | SEG | Adding a feature of sending state information only when the entire job is completed for any job linked to VPSX server. |
| | Requirement | SR-1506-000840 VO-1410-000185 | SEBJ SEA Korea | Adding a PC scanning feature using a USB cable. |
| | Requirement | TS-1508-000397 | SEDA | Supporting UBS flash drive in NTFS format. |
| | Requirement | SR-1509-000477 | Korea | Adding a feature for making a document box invisible to users who login as SWS when admin disables the box. |
| | Requirement | VO-1511-000153 SR-1601-000115 VO-1511-000059 TP1660B4 TP16610P | SECA Korea SEI | Adding a feature to allow users reboot a set at their desired time/cycle. |
| | Fixed issue | TS-1511-000581 TS-1511-000582 TS-1511-000583 | SEF | Improving the issue with intermittent failures when setting options for copy and/or authorization as Fleet Admin. |

V6.D6.16.01.08
1720
(2016-08-19)

| | | | |
|-------------|----------------------------------|-------------|--|
| Requirement | VO-1508-000490 | Korea | Disabling warning messages when the cover is open during platen scan. |
| Requirement | VO-1509-000398 | SEUK | Adding a delete and a preview feature during box printing. |
| Requirement | SR-1510-000416 | SELV | Modified to print a box-saved PRN file with Drive options that were applied when generating the PRN. |
| Requirement | VO-1511-000388 | SEF | Adding a feature to display telephone numbers or names (as saved in the address book) in the Fax Sent Report. |
| Requirement | VO-1411-000459 VO-1511-000431 | SENA SEF | Adding a Test button in the E-mail notification setting for an SMTP check. |
| Requirement | SR-1512-000207 | SAPL | Adding a feature to reset a user's personal accounting information. |
| Fixed issue | TP1640HA | SEAU SEF | Corrected the problem of a job being cancelled when Print job control is OFF and FDI balance is 0. |
| Fixed issue | SR-1512-000319 | SENA | Improving authentication errors when an FTP password contains ":". |
| Fixed issue | TS-1601-000638 | SEBN | Correcting the problem of test pattern not being printed in a service mode. |
| Fixed issue | TP16500K | SEF | Improving the recognition failure of Skip blank feature during a low resolution scan (100dpi). |
| Fixed issue | TP1650MP | SEG | Improving the issue of extra pages being intermittently printed when the low-temperature idling mode is enabled. |
| Fixed issue | Q1603_0175 | Korea | Improving the connection failure problem due to non-support for NOOP command in a certain SMTP server. |
| Fixed issue | TP1630CO | SEBN | Adding additional paper types in the selection during Google cloud printing. |
| Fixed issue | TP1630PW | Korea | Correcting intermittent failures of Color mode printing or color document being printed in mono during auto copying. |
| Fixed issue | Q1603_0263 | Korea | Correcting intermittent Power off malfunctions in NFC user interface. |
| Fixed issue | TP1640AE | SEAU | Improving intermittent Kerberos authentication errors due to timing issue after powering on/off. |
| Fixed issue | TP1640EO | SEBN | Improving poor Dutch translation. |
| Fixed issue | TP1640F8 | SEAU | Improving the issue of Multi destination emails not being sent when using a certain SMTP server. |
| Fixed issue | TP1640V9 | Korea | Improving rare cases of print page order being switched during a duplex copy. |
| Requirement | SR-1503-000854 | SEA | Adding a feature to recognize papers smaller than A4.Letter as A4.Letter during scanning. |
| Requirement | SR-1509-000006 | Korea | Adding a feature to include PSTN line state information in Fax Diagnostic Report. |
| Requirement | TP1650U601 | Korea | Supporting special characters (<, >, \, ") for a password. (If usage environments is solution, then need to B2B driver and solution) |
| Fixed issue | TP1630CY | Korea | Improving reading errors when using EPSoft card readers. |
| Fixed issue | TP16500S | SEA | Improving print errors due to wrongly generated data during LPD/LPR print data processing. |
| Fixed issue | N/A | DEV | Improving the issue of U3-3313 jams caused by intermittent paper slips. |
| Requirement | TP1650NU | SEAU | Adding a feature to require a PIN for a color print when selecting a color PIN mode. |
| Fixed issue | TP1640IT | SSA | Improving the issue of completed secure print job remaining on the job list. |
| Fixed issue | TP1630AU | SEA | When previewing PDF or TIFF images on Box App, the previewed image may have unexpected white blank on right side if it was scanned with mono mode. |
| Fixed issue | TP1630FS TP1661SE | SEA SECA | During Scanning with compact PDF option, Set locks up at times. |
| Fixed issue | TP16403C | SEAU | Fixing memory leakage issue according to repeated solution install/uninstall. |
| Fixed issue | TP1640IZ | SEG | The poor German translation(StauWdrherste) will be changed. |
| Requirement | SR-1508-000346 | SESA | Adding specific setting method through PJI command. - PCL font size, Tray1 paper size, Mp Tray paper size. |
| Fixed issue | TS-1603-000018 | SEUK | Correcting the problem of complex PDF document not being printed intermittently. |
| Requirement | TP1660DJ02 SR-1507-000265 | SEG SEAU | Adding Numeric keypad for PIN code input in solution (API only). |
| Requirement | | SEUK | Adding APK installation method in the Fleet Admin Pro. |
| Fixed issue | TP16613F | SEA | Fixing wrong IP address displaying on the notification screen in case of DHCP mode. |
| Fixed issue | TP16502T | SEA | Fixing powerpoint abnormal output from MAC office 2016. |
| Fixed issue | TP1640KG | SEG | Improving performance of 1-bit indexed color image document. |
| Fixed issue | TP16706H | SECH | Fixing printing job pending issue according to authentication fail. |
| Fixed issue | TP1650AD | Korea | Improving scanning speed when user sends many fax images. |

| | | | | |
|---|----------------|--------------------------|--|--|
| V6.D6.16 (15-July-2016) | Fixed issue | TP16500R | SEG | Fix inability to use '\$' character in Scan to SMB path. |
| | Fixed issue | Q1604-0185 Q1604-0320 | KOREA | Issue 1) Fix occasional progress bar freeze at 50%~60% during FW upgrade. Issue 2) Fix occasional wrong display of compatibility issues on all toners and IPC drums. |
| | Fixed issue | TP1650DL | SEA | Fix printing is not restarted after removing BinFull (H2-8A33) error from booklet finisher. |
| | Fixed issue | TP165051 | SME | Fix occasional inoperability on Copy Widget +/- buttons. |
| | Fixed issue | TP1660OX | KOREA | Fix printing jobs are held at times when burst job request is received. |
| V6.D6.13.EC1 603.06 (03-Jun-2016) | Fixed issue | TP1640DH | SEUK | Enhanced overall UI performance for a case where a device supports more than 501 external user IDs. |
| | Fixed issue | TS-1601-000563 | SESG | Fixed a job pending issue during Scan to SMB using NetApp SMB server. |
| | Fixed issue | TP16303L03 | SESG | Fixed an issue of user email not being prefilled in Send App during the Basic and Application Auth Mode while using Safecom solution. |
| | Fixed issue | TP16303L03 | SESG | Fixed an issue of Safecom pull print application closing immediately after a user login. Enhanced the safecom login operations for time-dependent cases. |
| | Fixed issue | TS-1601-000202 | SENA | Enhanced user login performance (reduced the login time) for a case where hundreds of secure print jobs are stored in a device. |
| | Fixed issue | TP1630D701 | SEI | Applied a scan authority checking process for a case where Dynamic Workflow is executed in the Application Auth mode before Send App launches after the device boots up. |
| | Fixed issue | TP1640XN | SEI | Enhanced copy widget performance for a case where a user tries to conduct a job immediately after a device boots up or wakes up from a power save mode. |
| | Fixed issue | TP1630TE | SEF | Disabled the PDF/A option for 600 dpi resolution in Send app. |
| | Fixed issue | TP1630HK | SEBN | Fixed an issue of not cloning the authentication status in the admin setting for printing. |
| | Fixed issue | TS-1601-000468 | SEAU | Fixed an issue of scan images having a light background when a scan job is done with an "Auto Color : Color/Mono" option on. |
| | Fixed issue | TP1630CM | SEA | Fixed an issue of device card login not working sometimes in a sleep mode. |
| | Fixed issue | TS-1602-000038 | SEA | Enhanced print performance for duplex images (color/mono mixed images). |
| | Fixed issue | TS-1603-000002 | SEA | Added more animations for paper jam clearing guidance. |
| | Fixed issue | TS-1511-000148 | SEA | Made Scan to FTP compatible with Serv-U FTP server. |
| | Fixed issue | TS-1601-000459 | SAPL | Fixed an issue of color options not being able to be saved as default in Quick Copy in a Device Authentication mode. |
| | Fixed issue | TP16400T04 | KOR | Fixed the login page sometimes displaying a white screen. |
| | Fixed issue | TP1630RG | KOR | Enhanced Copy widget printout performance to be as powerful as that of Copy App. |
| | Fixed issue | TP1640H0 | KOR | Enhanced secure job cancel function to delete received data completely. |
| | Fixed issue | TP165022 | KOR | Fixed Autologout not working sometimes in the Device UI. |
| | Fixed issue | - | - | MyPage App is restricted for external authenticated users as per the spec. |
| | Fixed issue | - | - | Fixed an issue of a machine continuously warming up due to C8-3314 (Toner Supply Error) when powered on. |
| | Requirement | - | - | Applied security compliance requirements from the Korean Government. |
| | Fixed issue | - | - | Fixed a finisher error (H2-8262) which occurred when executing a C-fold simplex print job right after a V-fold simplex print job. |
| | Fixed issue | - | - | Fixed a 4K-Finisher jam error which occurred when an OHP film is used for copy. |
| | Fixed issue | - | - | Fixed a print jam error which occurred when the inner finisher is installed during device wake-up. |
| | Fixed issue | - | - | Changed the version check policy to allow update for an engine sub firmware when the second sequence of its version name is different from the current one. |
| Fixed issue | - | - | Improved the management of the IP filtering feature and its default values. | |
| Fixed issue | N/A | KOREA | Print jobs are held at times when SecuThru (a secure printing software) is used. | |
| | TS-1602-000104 | SEAU | GCP service fails as an expired key is not refreshed. | |
| | N/A | SEAU | The fax redials the number that was previously entered when dialing using the fax keypad | |
| | N/A | SEAU | Send Job Cancel does not work at times right after starting Send Job when the Searchable | |
| | Requirement | N/A | SEA | New US standard setting values were applied. (Default values for US models) - Auto continue: ON |
| | Fixed issue | TS-1602-000076 | SEG | When making a searchable PDF with a 300 dpi or lower resolution, scanned images are cropped and the text on the scans is hard to read in MS Word. |
| | Fixed issue | TS-1601-000454 | SEAU | The device locks up intermittently during scan when Job Progress Window is off. |
| | Fixed issue | TS-1601-000564 | SEUK/SEG | Send does not work at times when Skip Blank Page is on. |
| Fixed issue | SR-1602-000397 | SEA | Scan to SMB fails if filename contains a space. | |

| | | | | |
|----------------------------------|-------------|----------------|--|---|
| V6.D6.16 (29-Jun-2016) | Fixed issue | TS-1512-000456 | SEBN | The number of copies cannot be selected when IPP printing in MAC OS. |
| | Fixed issue | N/A | KOREA | Scan to PC shortcuts generated in a previous version (Vx.C6.xx) do not work after upgrading to Vx.D6.06. |
| | Fixed issue | SR-1601-000384 | SEI/SEG | Fax confirmation reports are not printed to fit one page. |
| | Fixed issue | TP16307B | SEA | If the top bin of an inner finisher is selected as the output tray, UI progress information is updated slowly. Also, the device slows down when handling 15 copies or more. |
| | Fixed issue | SR-1601-000624 | SEA | If Home Lock is enabled for all users, duplicate icons appear on the Home screen at times. |
| | Fixed issue | SR-1601-000624 | SEA | If a user changes the setting of Copy Customizer, the copy OOB setting also changes. |
| | Fixed issue | TS-1602-000036 | SEA | The Compact PDF option does not work when scanning with the Auto Color Mode on. |
| | Fixed issue | TS-1602-000036 | SEA | Scan Adjustment was modified to work according to the default paper size (A4 or Letter) of a country/region in which the machine will be used. |
| | Fixed issue | TS-1601-000186 | SEA | An output tray selected for incoming faxes changes back to the default tray after waking up in a power save mode. |
| V6.D6.06 (08-Jan-2016) | Add Func | | | Support function to create "Web page" shortcuts on the main UI. |
| | Add Func | | | Support Scan ACS Function : In send app, "Auto" Mode (Automatic Color selection) is added. |
| | Add Func | | | V folding support for print jobs. |
| | Add Func | | | Added PIN only authentication mode. |
| | Add Func | | | Skip Blank Page feature for Scan/Copy implemented. |
| | Add Func | | | Error code and description improved. Provides detailed information. |
| | Add Func | | | Job Promotion Activation Feature implemented. |
| | Add Func | | | If 'Staple Empty' error added. The User can select Continue or Hold. |
| | Add Func | | | Add Oficio size for Copy, Scan. |
| | Add Func | | | Scan to SMB with browsing. |
| | Add Func | | | New application to help customers to download and upgrade ROM manually/automatically using Smart update application. |
| | Add Func | | | Support Searchable PDF + PDF/A option. |
| | Add Func | | | Reduced the file size of searchable PDF (OCR PDF). |
| | Add Func | | | SSL, TLS, None are supported for SMTP from SWS. |
| | Fix defect | | | The paper option is displayed Custom size on Apple device. |
| | Fix defect | | | When two interface (Ethernet/Wifi) have same IP Address. IP conflict error message will be displayed on UI board. |
| | Fix defect | | | ID/PW values for Job Accounting are missing when user sets 'Preset' feature supplied by O/S. |
| | Fix defect | | | The machine stops intermittently when the Customer is using the copy Widget. |
| | Fix defect | | | If Application Authentication is enabled, previously created short-cut does not work. |
| | Fix defect | | | Value of counter app is wrong for specific period. |
| | Fix defect | | | Not able to send fax for more than 15 recipients. |
| | Fix defect | | | The output has wrong page order of booklet. |
| | Fix defect | | | You may see that LCD is black after wakeup by touch or wakeup by jobs. |
| | Fix defect | | | File can not be deleted from Box. |
| | Fix defect | | | Fax is printed from incorrect tray after power save. |
| | Fix defect | | | Copy myprogram is not updated after edited and saved in home shortcut. |
| | Fix defect | | | DHCP renew does not work with P2 powersave. |
| Fix defect | | | Booklet printing speed is improved. | |
| Fix defect | | | User is not able to edit Wi-Fi IP settings. IP Setting menu from UI is disabled intermittently. | |
| Add func. | | | Support Korean language file name on ScanToPC menu. | |
| Add func. | | | Supply security patch for Apk integrity | |
| Fix defect | | | Fix defect that user can't cancel current job sometimes. | |
| Fix defect | | | Fix defect of showing S5-3111 error on UI after sending print job while machine stays in sleep mode. | |
| Fix defect | | | Fix defect that machine will not wake up from UI sleep mode in spite of wake up event. | |
| Fix defect | | | Fix defect that the overwrite function doesn't work when import address book CSV file under GUI. | |
| Fix defect | | | Fix wrong translation in Finnish. | |
| Fix defect | | | Fix Scan & send App to launch properly. | |
| Fix defect | | | Fix defect of not deleting job list in UI. | |
| Fix defect | | | Fix defect that XOA-Web login page issue. (showing home page instead of Xoa application page) | |

| | | |
|--|---|--|
| V6.C6.16 (1-Sep-2015) | Add func. | Supporting the filename in send UI allowing to enter currencies. |
| | Fix defect | Fix defect of not working copy widget. |
| | Add func. | Add function to Send App of removing destinations after the Job is started. |
| | Fix defect | Fix defect that the Send App was crashed while launching the program with Auto start option, sometimes. |
| | Add func. | Improve Inner Finisher feature. |
| | Fix defect | Fix defect of 3K Finisher error. |
| | Fix defect | Fix defect of rebooting by internal buffer overrunning. |
| | Fix defect | Fix defect of rebooting and broken image on 2-2 copy. |
| | Fix defect | Fix defect of broken image on duplex print (A5 SEF 2 - 2 book copy To MP Tray with Finisher). |
| | Fix defect | Fix defect that when user adds manual route entry in routing table through SWS after reboot, user defined entry is lost and user is not able to set Wifi as default gateway. |
| | Add func. | Add function of increased Font Size to 26 DP in Send application. |
| | Fix defect | Fix defect of fan control fault. |
| | Fix defect | Fix file name issue of Korean character in ScanToPC. |
| Fix defect | Fix defect that traditional Chinese is not applied in Settings. | |
| V6.C6.12 (9-Jul-2015) | Fix Defect | PowerSave is not working after Put down lifted ext. phone. |
| | | If a job is printing using MP tray, it sometimes loses its pages when there is not enough sheets of paper for the job. |
| | | Machine rebooted very very rarely at receiving in case Machine is turned on by soft power on. |
| | | For a Copy job, Original size detection is failed in case of ADF open. |
| | | Copy Save to box -> Store and print file name overwrite issue. |
| | | Scan to USB job is not happening after OHD Job. |
| | | SWS set 400% , Copy show 400 % . but output paper is 100%. |
| | | App crash is observed if user taps on to the UI while image loading is on progress. |
| | | Fix not for launching Send App. |
| | | AMPV Data fault. |
| | | Program shortcut is seen after wakeup from sleep(log-out state). |
| | | The remain on UI is different from the one on report. |
| | | PaperCut flicking issue. |
| | | Fix Jam issue (M2-2112 in MP tray). |
| | | Fax Widget hanged and need POPO when continuous jobs are performed. |
| | | Fix defect of disappearing Short cut icon after POPO. |
| | | Fix Fax Widget issue |
| | | Fixed memory issues, it was crashing applications due to low memory. |
| | | Change Watermark Icon. |
| | | After reboot, all Send programs was not displayed on HOME. |
| MFP was not discovered as Airprint device from MAC OS. | | |
| For a Copy job, Original size detection is failed in case of ADF open. | | |
| When AC Input Voltage reach under the specific value(V2: 200V), some errors(S1-3132...) occur. | | |
| V6.C6.07 (28-May-2015) | Fix Defect | 1. After installing EasyLauncher application and changing Authentication to Device mode, the |
| | | 2. The output of Build job for Copy does not be printed from the paper tray which user has |
| | | 3. For some SMTP sever, Scan to Email does not work properly due to excess mail size to |
| | | 4. Add Retry to 24V power function in order to solve "CCD Lock" error. |
| | | 5. Custom Paper size in Settings are not showed in Tray Confirmation pop-up window. |
| | | 6. Using C-Foding option with more than 4 paper is not available. |
| | | 7. When set the option of "Fold and Staple" with Booklet Finisher, stapling does not work. |
| | | 8. Improve the damage with roller mark which may be shown on 160mm from the top |
| | Add Func. | 1. Add new Hebrew strings. |
| | Fix Defect | 1. After Back up and Restore, Back up is not set(authorization. mode, application |
| | | 2. Fix a PCL6 error when print a A3 format by A4 size. |
| | | 3. Improve the delay to print a large sized PDF file. |
| | | 4. Wrong localized message for Communication Error string. |
| | | 5. LDAP issues and Auto log out issue. |
| | | 6. If user login before AA initialization, UI does not work with "Please wait" message. |
| | | 7. [Print Driver] Install/Print Performance Enhancement. |
| | | 8. Disable screen shot capture after restore the item is already set to disable but needs. |
| | | 9. Printing a job with Chinese name from USB does not work. |
| | | 10. DNS does not work when IPv6 is enabled. |
| | | 11. Improve scan quality of original image with Watermark. |
| | | 12. Language combo is not appearing in EDC save properties window in Win XP |
| | | 13. Change Custom sized paper type of MP tray to show in Tray Confirmation pop-up after |
| | | 14. Korean fonts from Safari AirPrint spool files are broken. |

V6.C6.04
(14-Apr-2015)

| | |
|--------------|--|
| | <p>15. Fix the custom paper size to save and show in Tray confirmation popup and Tray</p> <p>16. Add translation of Development Unit on SWS.</p> <p>17. Support 'Scan to SMB V3' protocol on Mac OS 10.10.</p> <p>18. Improve the printing time of A3 PDF file on MS Project.</p> <p>19. After power off using Power button on UI, FDI is not counted.</p> <p>20. Though booklet bin is full [M2-8A33], the output is ejected from booklet bin.</p> <p>21. Improve UI performance.</p> |
| Add Func. | <p>1. All individual setups in the Android UI can save in a backup file.</p> <p>2. Add stamp position TOP_CENTER / BOTTOM_CENTER for Copy.</p> <p>3. Apply background image & guide text on FDI block screen.</p> <p>4. Display the status of Log-In.</p> <p>5. Add a confirmation prompt to exit service mode as well as for memory clear.</p> <p>6. Add 'host name' to pull down menu of home screen.</p> <p>7. Authentication for Entering "Apps" Menu.</p> <p>8. Add to show a warning against the status of HomeScreen Lock.</p> <p>9. Add a localization of Taiwan.</p> <p>10. Add Fax Send Confirmation report.</p> <p>11. Add ID Send to box, but not to store in the USB device.</p> <p>12. Support Scandic letters when scan to email.</p> <p>13. Support Hebrew and Arabic font in 4th GUI.</p> <p>14. Support Newzealand model (Fax Ring Count is 3).</p> <p>15. Support SFE [032] - Line compensation for MS Excel.</p> <p>16. Add QR code that contains Device related data on Settings App. (Settings -> About System)</p> <p>17. Request to set Logout Confirmation popup to be enable or disable.</p> <p>18. Add a feature to remove deactivated scan ID from UI.</p> <p>19. Request to sort Korean alphabetically for Scan To Shared Folder list</p> <p>20. Support 'o' search filter in LDAP search and LDAP authentication.</p> <p>21. Support Scan to FTPs.</p> <p>22. Homepage customization of UI and remote distribution.</p> <p>23. Support Confidential Print icon as XOA solution.</p> <p>24. Support PrinterOn solution by PAR.</p> <p>25. Request for default user profile for users who logged in through 3rd party solution.</p> <p>26. Request supplies coverage data display on solutions (SyncThru, PrintFleet) by using SET MIB information.</p> <p>27. Support to select decreased image of first page on fax send report.</p> |
| Change Spec. | <p>1. Change the order of Toner from CMYK to YMCK.</p> <p>2. Adjustable width on SmartSearch pop-up, when enter in Send to Email.</p> <p>3. Change the color for destination text in ScanWidget.</p> <p>4. Paper weights(g) are added with each paper type in the window of tray confirmation popup.</p> <p>5. Expand the number of characters in password for secure print</p> <p>6. Change FaxWidget to be able to do another fax in processing.</p> <p>7. Change the method of showing Memory capacity (as Main+UI).</p> <p>8. Improve SWS Report feature view the printer report instead of printing to the printer.</p> <p>9. Change SFE [002] to include forcing Color Copy to print in mono.</p> <p>10. Add new warning message not to turn off the device during FW upgrade.</p> <p>11. Change to notify NFC FW Upgrade to users.</p> <p>12. Support a local card reader of China (same as MX4).</p> <p>13. Support to enable Application Authentication for Web Print application.</p> <p>14. Change to store job with C-Folding option.</p> <p>15. Expand LDAP Search max results from 300 to 500.</p> <p>16. Change to be disable to access PDF option if other file format except of PDF is selected in Scan&Send.</p> <p>17. Change to use UCS file as base table of Smart Color Manager.</p> <p>18. Admin password of many machines can be changable remotely at once.</p> <p>19. Disable manual input of email address on ScanToEmail.</p> <p>20. Add 480min as Power save time and disable Eco function.</p> <p>21. Implement Password validation to be handled in Send.</p> <p>22. Change ScanToFTP with configurable Communication Mode.</p> <p>23. Compatibility with HP UPD (Universal Printer Driver).</p> <p>24. Change Network PC FAX to support 500 recipients.</p> <p>25. Support Early Warm Up for fast printing.</p> <p>26. Support "Address Book -> Import" feature for both 'Append' and 'Overwrite'.</p> <p>27. Support multilanguage for creating Box - file/folder.</p> |

| | | |
|---------------------------|--------------|---|
| | | <p>28. Change the previous destination to clear after system timeout or if reset is pressed, although "Keep Previous Destination" is on.</p> <p>29. [Print Driver] Support Custom Tray Mapping and Paper Based Watermark.</p> <p>30. Improve to be able to change the settings of the SMTP server through SWAS.</p> <p>31. Change SPDS error code because are not same as the Device.</p> <p>32. Change the French translation from "Mon boite" to "MA BOITE".</p> <p>33. Remove the previous email address not to be remained in email address box to enter after using Scan & Send app.</p> <p>34. Change the German text from "Anwendungs mangement" to "Anwendungsmangement" in "UI->Settings->Application Management" menu.</p> <p>35. Change to save more that 20 of Machine ID&Fax numbers in Fax Setting.</p> |
| | Delete Func. | 1. Remove Online Registration from SWS > Maintenance > Links. |
| V6.B6.22 (6-Mar-2015) | Fix Defect | <p>1. After continous fax jobs are completed, Job window for showing the progress does not closed.</p> <p>2. UI is pending or Firmware update is going slow intermittenly during booting.</p> <p>3. Wakeup failure from Power save mode intermittenly.</p> <p>4. OPC Install Date Writing failure.</p> |
| | Change Spec. | 5. Seprate Fax Send report from the common report. |
| V6.B6.18 (29-Jan-2015) | Fix Defect | <p>1. Fix a poor print quality issue come from OPC corruption in a special temperture of difference in between internals and externals.</p> <p>2. [RADF] When starting a job, if user opened the ADF cover, sometimes ADF does not work.</p> <p>3. Wrong date is printed on receive site when sending a Fax.</p> <p>4. Some ISV application does not started after rebooting machine.</p> <p>5. Improve the process of Fax job submission because if add other destination of next fax job</p> <p>6. Duplex Transfer Voltage initiation timing change.</p> <p>7. Improve Regi Wrinkle.</p> |
| | Change Spec. | <p>1. [OPE] Change UI Firmware to be compatible with eMMC of KingSton.</p> <p>2. Send usage counter is different from between Counter app and Usage counter information.</p> |
| V6.B6.16 (17-Dec-2014) | Fix Defect | <p>1. Toner values for Cyan and Yellow are wrong displayed on UI.</p> <p>2. UI Black screen error during booting abnormally.</p> |
| | Fix Defect | <p>1. Fix pending on fax receiving by pressing stop button .</p> <p>2. Fix send app crashing issue.</p> <p>3. Possible to check other paper type on Tray 2, 8K paper.</p> <p>4. Main, Optional Ethernet initialized after Memory Clear.</p> <p>5. Improve LDAP searching function.</p> <p>6. Fax printing on unidentified phone number.</p> <p>7. Private folder ID can set up upto 64 byte.</p> <p>8. Improve SMB scan function.</p> <p>9. Modify Google Cloud Printing resister.</p> <p>10. Improve Fliker phenomenon.</p> <p>11. Improve line handling performance.</p> <p>12. Improve Scan to PC speed.</p> <p>13. Fix color simulation reset after demo page print.</p> <p>14. Add the wholly delete button on Fax widget.</p> <p>15. Fix Store and Print issue.</p> <p>16. Fix Stop button issue on MP Tray.</p> |
| V6.B6.12 (13-Nov-2014) | Fix Defect | <p>1. Add the button to delete task at once.</p> <p>2. Improve LDAP searching function.</p> <p>3. Support DFS (Distributed File System) option on SWS.</p> <p>4. Number keypad defaulted when PIN code log-in.</p> <p>5. Add saving option the created local user to address book.</p> <p>6. Add Scan Masking Area Adjustment on Tech Mode.</p> <p>7. Add Send tap destination Adjustment.</p> <p>8. Support A5 size LEF printing.</p> <p>9. Add delete option for default application .</p> <p>10. Add function for playing video clip on USB memory.</p> <p>11. Add the function of WiFi / Active NFC.</p> <p>12. Add Myfax option in +Me setting.</p> <p>13. Add sharing function on Box App.</p> <p>14. Add Index scrolling in address book.</p> <p>15. Support Scan to Me.</p> <p>16. Add VNC fuction (Virtual Network Computing).</p> <p>17. Add Sharing function Send APP to other APPS.</p> |
| | Add Func. | |

| | |
|---|---|
| | 18. Support prefix dial on Fax widget. |
| | 19. Add Wi-Fi icon when connected. |
| | 20. Add duplex printing option when printing in USB. |
| | 21. Add option of Web print APP disable. |
| | 22. Add Haptic function to all menu. |
| | 23. Add Web address function of auto complet, progress bar, delete at once. |
| | 24. Add the button to delete task at once. |
| Change Spec. | 1. Delete initial page on Copy shortcut. |
| | 2. Initialize the copy option when click the Interupt during copying. |
| | 3. Auto paper detection when using the scan widget. |
| | 4. Improve resolution of Demo Page. |
| | 5. Improve UX usability. |
| | 6. Improve the searching usability of LDAP address book. |
| | 7. Automatically destinate to USB when insert USB memory. |
| | 8. Add extra stamp position . |
| | 9. Enlarge the size of number on Fax widget. |
| | 10. Home Screen Setting authorized by admin, not user. |
| | 11. Always wake up the Panel during video clip play. |
| | 12. Remain recipient after Scan and Send execute. |
| | 13. Add enter the copies number function in Copy widget. |
| | 14. Shows defaultly number keypad in Fax widget. |
| | 15. Create single PDF/TIFF files by scan. |
| | 16. Display lock image on Secure PDF. |
| | 17. Admin has authorize to delete the private folder. |
| | 18. Default color setting of Copy widget is synchronized with Copy APP. |
| 19. Email notification of Counter Report includes essital contents. | |
| 20. Copy APP's preview can change to Number keypad. | |
| 21. Reduce Scan noise. | |
| Delete Func. | 1. Remove user information from Logs. |
| | 2. Remove "Ready to Copy" string placed on right bottom of Panel. |